

Page 1 of 1
Invoice No.: 1316
Date: 1-Jul-2015
1964 Porsche 356C Carrera 2 Cab
VIN: 159548
LIC: N/A

INVOICE

LABOR				Amount	
See Sublet section.				\$0.00	
PARTS					
Item	Part Number	Qty	Price	Total	Shipping
N/A					
Sublet Charges				Total	Shipping
Load and pick up car in Incline Village, NV and deliver Redwood City, CA.				\$750.00	
Unload vehicle and place into vehicle and parts into warehouse.					
Fuel for transport				\$84.15	
Bridge Toll - Benica				\$25.00	
Travel expenses flight, taxi, parking & food.				\$917.41	
Recommendations and Technicians Notes					
Hardtop with the electric sunroof is at Jim Rinker's shop. The vehicle will go to Jim's shop to have the paint chips repaired and hard top restored and fitted to the vehicle.					
Sub Totals					
Parts				\$0.00	
Sales Tax @ 9.0%				\$0.00	
Labor				\$0.00	
Sublet				\$1,776.56	
Shipping				\$0.00	
CA Environmental Fees				\$0.00	
Total Amount				\$1,776.56	

Page 1 of 2
Invoice No.: 1378
Date: 1-Oct-2016
1964 Porsche 356C Carrera 2 Cab
VIN: 159548
LIC: N/A

INVOICE

LABOR				Amount	
See Sublet section.				\$0.00	
PARTS					
Item	Part Number	Qty	Price	Total	Shipping
NGK B7ES Standard Plug	NGK 1111	8	\$2.27	\$18.16	
NGK B8EG Competition Plug	NGK 3430	8	\$3.57	\$28.56	
Battery, 12V Special Order	DEB 9A75DT	1	\$181.67	\$181.67	
Original Porsche 356C		1	\$1,100.00	\$1,100.00	
Carrera 2 Owner Manual					
Sublet Charges				Total	Shipping
Gretener Prototype Engineering:					
Load and pick up hard top at Riker Toys.				\$400.00	
Unload hard top and place into warehouse.					
Global Registry:					
DMV Fees paid in advance for client.				\$45.00	
Generate new duplicate title in Montana.					
Verification of serial number (VIN) - Location Service Charge				\$165.00	
Special walk through Title in Sacramento.				\$345.00	
California Certificate of Title issued - Without appearance of Client at DMV.					
Fedex				\$26.13	
UPS				\$24.00	
Shipping				\$16.20	
Travel expenses - Food, lodging, transportation, parking, tolls, etc. to vendors.				\$0.00	

Invoice No.: 1378

Page 2 of 2
Date: 1-Oct-2016

Recommendations and Technicians Notes

Hardtop with the electric sunroof is at the warehouse. The vehicle will go to Jim's shop to have the paint chips repaired.

Urs Gretener will restore the metal work on the hard top and fit to the vehicle.

Sub Totals

Parts	\$1,328.39
Sales Tax @ 9.0%	\$119.56
Labor	\$0.00
Sublet	\$1,021.33
Shipping	\$0.00
CA Environmental Fees	\$0.00

Total Amount	\$2,469.28
---------------------	-------------------

Page 1 of 1
Invoice No.: 1424
Date: 15-Nov-2016
1964 Porsche 356C Carrera 2 Cab
VIN: 159548
LIC: N/A

INVOICE

LABOR

Amount

See Sublet section.

\$0.00

PARTS

Item	Part Number	Qty	Price	Total	Shipping
Bosch Fuel Filter	91 01	1	\$18.44	\$18.44	
Carburetor Kits	Solex	2	\$65.74	\$131.48	
Carburetor Cleaner	BER 0117C	2	\$4.27	\$8.54	
Dual Foot	TRF 17-525	1	\$10.17	\$10.17	
Fuel, 100 Octane Race Gas	Sunoco 110	1	\$55.95	\$55.95	

Sublet Charges

Total Shipping

Vehicle is hard to start and doesn't idle or run well at low rpm.

Great Marques:

Disassemble both Solex carburetors.

\$300.00

Make sure all passageways are clear.

Clean carburetors and install new gaskets.

Travel expenses - Food, lodging, transportation, parking, tolls, etc. to vendors.

\$0.00

Recommendations and Technicians Notes

Urs Gretener to restore the hardtop with the electric sunroof.

Sub Totals

Parts	\$224.58
Sales Tax @ 9.0%	\$20.21
Labor	\$0.00
Sublet	\$300.00
Shipping	\$0.00
CA Environmental Fees	\$0.00

Total Amount

\$544.79

Page 1 of 2
Invoice No.: 1444
Date: 30-Jan-2017
1964 Porsche 356C Carrera 2 Cab
VIN: 159548
LIC: N/A

INVOICE

LABOR

Amount

See Sublet section.

\$0.00

PARTS

Item	Part Number	Qty	Price	Total	Shipping
Air Cleaner top Bolts, 356	6x100MMx140MM	25	\$3.00	\$75.00	
Air Cleaner Washers, Flat	6MM Flat	25	\$0.50	\$12.50	
Fuel, 100 Octane Race Gas	Sunoco 110	1	\$55.95	\$55.95	
CAD-1 Plating - Air Cleaner Bolts & Washers		1	\$75.00	\$75.00	

Sublet Charges

Total Shipping

Vehicle is hard to start and doesn't idle or run well at low rpm.

Know-TEQ (Craig Kenney):

Fouled spark plugs.

Remove air cleaners, lower side pods, both carburetors,
cross linkage, both distributors, distributor caps, wiring looms and
all spark plugs.

\$800.00

Replace with NGK spark plugs.

Wires are incorrect. They are over-insulated and can't get a firing pulse in
any timing gun.

Had to make two faux wires for cylinder #1 in order to get a timing pulse.

Remove the faux wires at the end of the job.

Re-install carburetors that were gone through by Rick Thiele with new
base seals.

Chase all damage in carburetor tops (new bolts), plugs, distributors,
fiddle with the tuning, wiring looms, etc.

Struggle with jetting the carburetors to sea level.

The carburetors had been set up to run at 6000ft (Incline Village, NV).

Car starts easily when cold. Struggles until heat gets in.
Hold a "fast idle" with rpm at approximately 1200 - 1300 rpm (no higher)
for at least two - three minutes and then drop to 1000 - 1100 rpm.

Have Rick Thiele (Great Marques) flush, clean and inspect the Solex
40 P11/4 carburetors. They were crud filled, usual jet ports clogged, etc.
We spun up the distributors.

While "ok" for a street car the lower distributor does have some erratic
action at idle and likely has a worn pivot pin and phenolic "bump pad".
This can be seen only using a timing gun and is illustrated with
occasional erratic 3 - 4 degree movement of idle speed ignition firing
in both directions of advance and idle. There is no erratic action at the
much more important higher rpm ranges (1500 - 2400 rpm max advance
range.)

Shipping - UPS	\$23.83
----------------	---------

Travel expenses - Food, lodging, transportation, parking, tolls, etc. to vendors.	\$0.00
---	--------

Recommendations and Technicians Notes

The shocks are leaking. Determine if they can be rebuilt.

The tires are over 15 years old. They need to be replaced.

The vehicle will need to go to Jim Rinker's shop to have the paint chips repaired
and hard top painted and fitted to the vehicle.

Urs Gretener to restore the hardtop.

Vehicle is at Great Marques having a major service performed.

Sub Totals

Parts	\$218.45
Sales Tax @ 8.75%	\$19.11
Labor	\$0.00
Sublet	\$823.83
Shipping	\$0.00
CA Environmental Fees	\$0.00

Total Amount	\$1,061.39
---------------------	-------------------

Page 1 of 3
 Invoice No.: 1453
 Date: 15-Sep-2017
 1964 Porsche 356C Carrera 2 Cab
 VIN: 159548
 LIC: N/A

INVOICE

LABOR

Amount

See Sublet section.

\$0.00

PARTS

Item	Part Number	Qty	Price	Total	Shipping
Sump Gaskets		2	\$3.50	\$7.00	
Brake Fluid, pints		2	\$6.95	\$13.90	
Starter Boot		1	\$8.95	\$8.95	
Engine Oil	20W-50	8.5	\$12.95	\$110.08	
Environmental Charges		1	\$6.50	\$6.50	
Pirelli Cinturato 165VR15	165VR15 CN36 N4	5	\$233.10	\$1,165.50	
Freight	Freight	1	\$81.00	\$81.00	
Shock Parts:					
Cleaning Solvents, Consumables	Sundry	1	\$6.95	\$6.95	
Piston 27mm	70.12.00.034.4	4	\$18.91	\$75.64	
Piston Band, PTFE, 27mm	15.12.02.009.1	4	\$3.09	\$12.36	
Res. Tube Seal Nut Type 41mm	80.25.00.023.0	4	\$17.64	\$70.56	
Guide Assembly 41mm	80.22.20.012.0	4	\$60.16	\$240.64	
Inner Cylinder 80 Series 27mm	70.17.10.410.0	2	\$32.19	\$64.38	
Footvalve, 101.1 lbs@13in/s	80.14.04.003.1	4	\$18.79	\$75.16	
Piston Rod Solid 453mm	12.10.14.453.0	4	\$70.44	\$281.76	
Sandblast, prime & paint per damper		4	\$50.00	\$200.00	
Specialized Damper Paint		1.6	\$8.00	\$12.80	
Fixing Eye for 0	70.52.03.008.0	8	\$5.34	\$42.72	
Bushing Eye Rubb	13.23.34.016.1	8	\$2.27	\$18.16	
80 Series Dust Bell	80.28.00.007.0	4	\$8.95	\$35.80	
Freight	Freight	1	\$38.35	\$38.35	

Sublet Charges

Total Shipping

Perform major service.

Great Marques:

Change engine oil and clean the filter.

Flush and change the brake fluid.

Flush and change the transmission fluid.

Install the starter cable boat.

Check battery.

\$675.00

Shocks are leaking.

Determine if the original Porsche Type 4 shocks, built by Koni, can be rebuilt and appropriate parts found.

Remove shocks and wheels.

Send out the shocks to be rebuilt by the authorized Koni rebuilder.

Reinstall rebuilt shocks and test.

Right front wheel is bent.

The tires are over 15 years old. They need to be replaced.

Install five new tires and move the spare wheel to the right front and move the right front wheel to become the spare.

Performance Shock (PSI):

Rebuild original Porsche/Koni Type 4 shock set.

Original OEM Koni shocks as received.

Mounting eyes do not have replacable rubber.

On inspection found rods and shock internals worn.

Shocks had been rebuilt incorrectly previously with incorrect seals and guides being used.

Shocks fully inspected and reassembled with original Koni parts and seals.

New mounting eyes welded on which use current Koni shock mounting rubber.

Pistons all upgraded to current 27mm standard from 25mm which is no longer supported by Koni.

\$675.00

Replace original piston shafts and re-weld dust cover and mounting eyes.

\$337.50

Mount and balance five new tires.

\$150.00

Shipping

\$28.75

Travel Expenses - Food, lodging, transportation, parking, tolls, etc. to vendors.

\$0.00

Invoice No.: 1453

Page 3 of 3
Date: 15-Sep-2017

Recommendations and Technicians Notes

N/A

Sub Totals

Parts	\$2,568.21
Sales Tax @ 9.25%	\$237.56
Labor	\$0.00
Sublet	\$1,866.25
Shipping	\$0.00
CA Environmental Fees	\$6.50

Total Amount	\$4,678.51
---------------------	-------------------

Page 1 of 2
 Invoice No.: 1662
 Date: 6-Aug-2020
 1964 Porsche 356C Carrera 2 Cab
 VIN: 159548
 LIC: N/A

INVOICE

LABOR

Amount

See Sublet section.

\$0.00

PARTS

Item	Part Number	Qty	Price	Total	Shipping
Brad Penn Engine Oil	20W50	9	\$11.50	\$103.50	
Sump Gaskets		1	\$6.00	\$6.00	
Brake Fluid		1	\$19.00	\$19.00	
Solex Carburetor Part		1	\$100.00	\$100.00	
Spark Plug		8	\$3.65	\$29.20	
Air Cleaner Adapter		2	\$125.00	\$250.00	
Distributor Plate		1	\$75.00	\$75.00	
Points, (Good) Used		1	\$100.00	\$100.00	
Weber 40 IDF Carburetors	18.950.160	2	\$324.93	\$649.86	
Porsche 356 Adapter Plates	99.004.050	1	\$91.77	\$91.77	
Choke, 40 IDF	71.506.340	4	\$17.16	\$68.64	
Main Jet	73.401.130	4	\$3.70	\$14.80	
Air Corrector Jet	77.401.175	4	\$3.70	\$14.80	
Adjustable Throttle Link 5 11/16" to 6 1/16"	75.500.150	2	\$19.53	\$39.06	
Adjustable Throttle Link 7 11/16" to 8 1/16"	75.500.200	2	\$19.53	\$39.06	
Emulsion Tube Holder	52.580.001	4	\$10.13	\$40.52	
Freight In	Freight	1	\$26.90	\$26.90	
Cadmium Plating	Plating	1	\$350.00	\$350.00	
Freight - Cad Plating	Freight	1	\$56.00	\$56.00	
Freight - Distributors	Freight	1	\$69.00	\$69.00	

Sublet Charges

Total Shipping

Vehicle is hard to start and doesn't idle or run well at low rpm.
 Perform Annual Chassis/Fluid Service on Vehicle.

Invoice No.: 1662

Page 2 of 2
Date: 6-Aug-2020

Ansire Inc. (Jim Ansire):	
Remove carburetors.	\$1,875.00
Remove exhaust side pipes.	
Repair exhaust.	
Lube and adjusted front end.	
Perform engine oil change.	
Installed and loaned an oil filter element.	
Change spark plugs.	
Perform a compression test and leak down test.	
Flush and bleed brakes.	
Diagnose and repair/rebuild distributors.	\$1,280.00
Travel expenses (food, lodging, transportation, parking, etc.) to various vendors.	\$0.00

Recommendations and Technicians Notes

The vehicle will need to go to Jim Rinker's shop to have the paint chips repaired and hard top painted and fitted to the vehicle.
Urs Gretener to restore the hardtop.

Sub Totals

Parts	\$2,143.11
Sales Tax @ 9.25%	\$198.24
Labor	\$0.00
Sublet	\$3,155.00
Shipping	\$0.00
CA Environmental Fees	\$0.00

Total Amount	\$5,496.35
---------------------	-------------------

Page 1 of 2
Invoice No.: 1680
Date: 3-Sep-2020
1964 Porsche 356C Carrera 2 Cab
VIN: 159548
LIC: N/A

INVOICE

94063
(650) 364-7062

LABOR	Amount
See Sublet section.	\$0.00

PARTS

Item	Part Number	Qty	Price	Total	Shipping
Weber Carburetor Linkage Brackets		2	\$175.00	\$350.00	
Intake Manifold Washers and Hardware		1	\$65.00	\$65.00	
Carburetor Cross Bar Linkage & Balls		1	\$200.00	\$200.00	
Intake Manifold Gasket		4	\$8.50	\$34.00	
Custom Intake Manifold	GPE	2	\$900.00	\$1,800.00	
Fan Belt		1	\$18.00	\$18.00	
Fuel Hose		2	\$12.00	\$24.00	

Sublet Charges	Total	Shipping
----------------	-------	----------

Vehicle is hard to start and doesn't idle or run well at low rpm.
Perform Annual Chassis/Fluid Service on Vehicle.

Ansite Inc. (Jim Ansite):
Installed new Weber 40 IDF carburetors and adapter plates from
Weber Carburetor Restoration (Pierce Manifolds).
Does not work as the deck lid on the cabriolet is too low.
New intake manifolds will be required to bring the height down.
Removed the sheet metal so new intake manifolds can be made.
Shimmed the engine deck lid as it was dragging on top.
Made new carburetor linkage.

Installed new fabricated intake manifolds.
Installed carburetors and linkage.
Installed repaired distributors.
Timed the distributors.
Installed all removed sheet metal.
Setup carburetor linkage.

Invoice No.: 1680

Page 2 of 2
Date: 3-Sep-2020

Travel expenses (food, lodging, transportation, parking, etc.) to various vendors. \$0.00

Recommendations and Technicians Notes

Gretener Prototype Engineering custom fabricated the intake manifolds.
The vehicle will need to go to Jim Rinker's shop to have the paint chips repaired and hard top painted and fitted to the vehicle.
Urs Gretener to restore the hardtop.

Sub Totals

Parts	\$2,491.00
Sales Tax @ 9.25%	\$230.42
Labor	\$0.00
Sublet	\$4,250.00
Shipping	\$0.00
CA Environmental Fees	\$0.00

Total Amount **\$6,971.42**

Page 1 of 2
 Invoice No.: 1710
 Date: 6-Dec-2020
 1964 Porsche 356C Carrera 2 Cab
 VIN: 159548
 LIC: N/A

INVOICE

LABOR

Amount

See Sublet section.

\$0.00

PARTS

Item	Part Number	Qty	Price	Total	Shipping
Abrasive and Sanding Materials		1	\$32.00	\$32.00	
Body Lead Work Supplies		1	\$46.00	\$46.00	
Undercoating and Primer		1	\$10.00	\$10.00	
15mm ID Hose, per ft	GPE-356-GTOH	6	\$38.00	\$228.00	
15mm Straight Hose Fitting	GPE-356-GTOSTF	4	\$95.00	\$380.00	
Hose Collar		4	\$15.00	\$60.00	
Welding Supplies		1	\$23.00	\$23.00	

Sublet Charges

Total

Shipping

Body repair / correction on nose section of vehicle.

Gretener Prototype Engineering:

Removed front bumper, head lights, grills, horns,
 running lights, cross over oil lines, oiler coolers
 and cooler shrouds.

\$3,105.00

Removed paint on right front nose section.
 Melted off lead work to expose damaged section on nose.
 Fabricated new nose section and installed (welded).
 Metal finish section and fit hood.
 Lead work gap to hood and grill openings.
 Metal finished section and fit hood.
 Lead work gap to hood and grill openings.
 Metal finished and sanded lead work.

Installed front bumper and checked gap.
 Disassembled bumper trim and guards.
 Removed paint on left side of on bumper joint.

Invoice No.: 1710

Page 2 of 2
Date: 6-Dec-2020

Travel expenses (food, lodging, transportation, parking, etc.) to vendors.	\$0.00
--	--------

Recommendations and Technicians Notes

The vehicle will need to go to Jim Rinker's shop to have the paint chips repaired and hard top painted and fitted to the vehicle.

Urs Gretener to restore the hardtop.

Sub Totals

Parts	\$779.00
Sales Tax @ 9.25%	\$72.06
Labor	\$0.00
Sublet	\$3,105.00
Shipping	\$0.00
CA Environmental Fees	\$0.00

Total Amount	\$3,956.06
---------------------	-------------------

Page 1 of 2
Invoice No.: 1715
Date: 6-Jan-2021
1964 Porsche 356C Carrera 2 Cab
VIN: 159548
LIC: N/A

INVOICE

LABOR				Amount	
See Sublet section.				\$0.00	
PARTS					
Item	Part Number	Qty	Price	Total	Shipping
N/A				\$0.00	
Sublet and Labor Charges				Total	Shipping
Body repair / correction on nose section of vehicle.					
Gretener Prototype Engineering: Cut bumper joint loose to reshape contour to follow left nose section gap. Welded bumper and applied lead on bumper joint and metal finished. Primered and applied under coating on inside of new nose section.				\$2,025.00	
Disassembled oil coolers. Replaced all soft oil line hose sections and fittings. Assembled coolers and installed to chassis. Ran engine and checked for leaks. Installed front bumper.				\$1,080.00	
Travel expenses (food, lodging, transportation, parking, etc.) to various vendors.				\$0.00	

Recommendations and Technicians Notes

The vehicle will need to go to Jim Rinker's shop to have the paint chips repaired, paint the nose and bumper repairs, paint the hard top and fit to the vehicle.

Urs Gretener to restore the hardtop.

Invoice No.: 1715

Page 2 of 2
Date: 6-Jan-2021

Sub Totals

Parts	\$0.00
Sales Tax @ 9.25%	\$0.00
Labor	\$0.00
Sublet	\$3,105.00
Shipping	\$0.00
CA Environmental Fees	\$0.00

Total Amount	\$3,105.00
---------------------	-------------------

Page 1 of 2
 Invoice No.: 1719
 Date: 5-Feb-2021
 1964 Porsche 356C Carrera 2 Cab
 VIN: 159548
 LIC: N/A

INVOICE

LABOR

Amount

See Sublet section.

\$0.00

PARTS

Item	Part Number	Qty	Price	Total	Shipping
Welding Supplies, Lead Solder	Lead Solder	2	\$37.00	\$74.00	
Metal Supplies	GPE Supplies	1	\$45.00	\$45.00	
Abrasive & Sanding Supplies	GPE Supplies	1	\$57.00	\$57.00	
Epoxy Primer Kit	Primer	1	\$116.80	\$116.80	

Sublet Charges

Total Shipping

Reutter Hardtop repair / correction / restoration.

The hard top is an original Porsche hard top with a sun roof with heavily rusted hard top frame and rails.

Gretener Prototype Engineering:

Disassemble the entire roof track system and mechanisms.

\$9,990.00

Pulled out sunroof panel and removed headliner.

Stripped paint on out side of roof and sunroof panel.

Dropped off hard top at sand blaster.

Primed inside of roof structure.

Fabricated left and right B pillar.

Fabricated C pillar inner and outer.

Fabricated rear window frame inner and outer.

Fabricated side window frame inner and outer skin.

Fabricated new rear roof drain tubes.

Fabricated main mounting brackets rear inner nut plates for hold down bracket.

Fabricated rubber seal receiver channel for main seal.

Invoice No.: 1719

Page 2 of 2
Date: 5-Feb-2021

Spot welded all inner structure and installed to main frame.
Replaced front leading edge panel up to sun roof opening.
Replaced inner channel to meet edge panel.

Travel expenses (food, lodging, transportation, parking, etc.) to various vendors. \$0.00

Recommendations and Technicians Notes

The hard top with the electric sun roof is in very bad shape. It requires extensive repairs and restoration. Then the vehicle and hard top will need to go to Jim Rinker to be painted and have the aluminum trim fitted.

Sub Totals

Parts	\$292.80
Sales Tax @ 9.25%	\$27.08
Labor	\$0.00
Sublet	\$9,990.00
Shipping	\$0.00
CA Environmental Fees	\$0.00

Total Amount **\$10,309.88**

Page 1 of 2
Invoice No.: 1727
Date: 5-Mar-2021
1964 Porsche 356C Carrera 2 Cab
VIN: 159548
LIC: N/A

INVOICE

LABOR

Amount

See Sublet section.

\$0.00

PARTS

Item	Part Number	Qty	Price	Total	Shipping
Brake Fluid	ATE	1	\$16.20	\$16.20	
Brake Line, Front	Brake Line	2	\$27.80	\$55.60	
Brake Line, Rear	Brake Line	2	\$31.00	\$62.00	

Sublet Charges

Total Shipping

Reutter Hardtop repair / correction / restoration.
The hard top is an original Porsche hard top with a sun roof with heavily rusted hard top frame and rails.

Gretener Prototype Engineering:
Remove existing soft top from vehicle. \$4,995.00
The soft top and hard top cannot be installed on the vehicle at the same time.
Fitted hard top roof to adjust fitment and prepped for final welding.
Metal finished outer skin (bump and file).
Applied lead on all welded and previously leaded areas and metal finished.

Removed dents on sunroof panel and metal finished.
Installed track rails.
Installed sunroof panel.
Inserted rubber seal on front and rear channels.
Final install and made some adjustments on locking tabs.

Found brake fluid leaks.
Replaced front and rear brake lines (soft lines).
Drained brake fluid and replaced with new fluid.
Bled brakes.

Sand blasting of various components. \$320.00

Invoice No.: 1727

Page 2 of 2
Date: 5-Mar-2021

Travel expenses (food, lodging, transportation, parking, etc.) to various vendors. \$0.00

Recommendations and Technicians Notes

The vehicle and hard top will need to go to Jim Rinker to be painted and have the aluminum trim fitted.

Sub Totals

Parts	\$133.80
Sales Tax @ 9.25%	\$12.38
Labor	\$0.00
Sublet	\$5,315.00
Shipping	\$0.00
CA Environmental Fees	\$0.00

Total Amount **\$5,461.18**

Page 1 of 2
Invoice No.: 1736
Date: 16-Mar-2021
1964 Porsche 356C Carrera 2 Cab
VIN: 159548
LIC: N/A

INVOICE

LABOR

Amount

See Sublet section.

\$0.00

PARTS

Item	Part Number	Qty	Price	Total	Shipping
Metal Conditioner, Filler, Urethane Primers and abrasives	Meza Paint	1	\$508.15	\$508.15	

Sublet Charges

Total Shipping

Body repair / correction on nose section of vehicle.
Reutter Hardtop repair / correction / restoration.
The hard top is an original Porsche hard top with a sun roof with heavily rusted
hard top frame and rails.

RinkerToys (Jim Rinker):
Disassemble quarter window and top latches. \$2,760.00
Send for chrome.
Fit sunroof components to test for proper function.
Adjust and detail as needed.
Prep hardtop for primer application
Minor details as needed.

The wood steering wheel is delaminating. Needs to be sent out for repair.

Enclosed vehicle and hard top transport from G.P.E. to Valley Center, CA. \$875.00
load and unload vehicle and parts.

Travel expenses (food, lodging, transportation, parking, etc.) to various vendors. \$0.00

Recommendations and Technicians Notes

The hard top with the electric sun roof is in very bad shape. It required
extensive repairs and restoration.
The wood steering wheel is delaminating and needs to be sent out for repair.

Invoice No.: 1736

Page 2 of 2
Date: 16-Mar-2021

Sub Totals

Parts	\$508.15
Sales Tax @ 9.25%	\$47.00
Labor	\$0.00
Sublet	\$3,635.00
Shipping	\$0.00
CA Environmental Fees	\$0.00

Total Amount	\$4,190.15
---------------------	-------------------

Page 1 of 2
Invoice No.: 1740
Date: 1-Apr-2021
1964 Porsche 356C Carrera 2 Cab
VIN: 159548
LIC: N/A

INVOICE

LABOR	Amount
See Sublet section.	\$0.00

PARTS

Item	Part Number	Qty	Price	Total	Shipping
Freight for Sunroof Motor, Steering Wheel & Chrome	Freight	1	\$60.56	\$60.56	

Sublet and Labor Charges	Total	Shipping
--------------------------	-------	----------

Body repair / correction on nose section of vehicle.
Reutter Hardtop repair / correction / restoration.
The hard top is an original Porsche hard top with a sun roof with heavily rusted
hard top frame and rails.

RinkerToys (Jim Rinker): Prime and block the hardtop for straightness.	\$4,200.00
---	------------

Sand nose panel and repair paint chips.
Fill, prime and block nose panel for straightness.
Sand the front bumper.
Fill, prime and block the front bumper for straightness.

The sunroof motor is for a 6V electrical system.
Ship sunroof motor out for 12V conversion.

Ship the steering wheel to Bruce Crawford for repairs.

Travel expenses (food, lodging, transportation, parking, etc.) to various vendors.	\$0.00
--	--------

Recommendations and Technicians Notes

The hard top with the electric sun roof is in very bad shape with heavily rusted
hard top frame and rails. It requires extensive repairs and restoration.
The wood steering wheel is delaminating and was sent out for repair.

Invoice No.: 1740

Page 2 of 2
Date: 1-Apr-2021

Sub Totals

Parts	\$60.56
Sales Tax @ 9.25%	\$5.60
Labor	\$0.00
Sublet	\$4,200.00
Shipping	\$0.00
CA Environmental Fees	\$0.00

Total Amount	\$4,266.16
---------------------	-------------------

Page 1 of 2
Invoice No.: 1744
Date: 5-May-2021
1964 Porsche 356C Carrera 2 Cab
VIN: 159548
LIC: N/A

INVOICE

LABOR				Amount	
See Sublet section.				\$0.00	
PARTS					
Item	Part Number	Qty	Price	Total	Shipping
9300 Black Urethane, DCX Hardener, DP Sealer and DP Reducer		1	\$338.45	\$338.45	
Sublet and Labor Charges				Total	Shipping
Body repair / correction on nose section of vehicle.					
Reutter Hardtop repair / correction / restoration.					
The hard top is an original Porsche hard top with a sun roof with heavily rusted hard top frame and rails.					
RinkerToys (Jim Rinker):				\$2,880.00	
Finish preparing the hard top for paint.					
Prime and block for straightness.					
Apply first coat of paint in 9300 Black Urethane paint.					
Prep for second coat.					
Complete paint work on hard top.					
Waiting for appointment with Autos International for headliner and trim.					
Eurton Electric will be converting the electric sunroof motor to 12 volts.					
Need to duplicate the quarter windows. Aircraft Windshield will perform this work.					
Bruce Crawford will be repairing and refinishing the steering wheel.					
Travel expenses (food, lodging, transportation, parking, etc.) to various vendors.				\$0.00	

Invoice No.: 1744

Page 2 of 2
Date: 5-May-2021

Recommendations and Technicians Notes

The hard top with the electric sun roof is in very bad shape with heavily rusted hard top frame and rails. It requires extensive repairs and restoration.
The wood steering wheel is delaminating and was sent out for repair.

Sub Totals

Parts	\$338.45
Sales Tax @ 9.25%	\$31.31
Labor	\$0.00
Sublet	\$2,880.00
Shipping	\$0.00
CA Environmental Fees	\$0.00

Total Amount	\$3,249.76
---------------------	-------------------

Page 1 of 2
Invoice No.: 1749
Date: 26-May-2021
1964 Porsche 356C Carrera 2 Cab
VIN: 159548
LIC: N/A

INVOICE

LABOR

Amount

See Sublet section.

\$0.00

PARTS

Item	Part Number	Qty	Price	Total	Shipping
Fabricate Quarter Windows	Fabricate	1	\$380.20	\$380.20	
Chrome Latches	Chrome	1	\$646.28	\$646.28	
6V to 12V Conversion Parts		1	\$77.62	\$77.62	

Sublet and Labor Charges

Total Shipping

Body repair / correction on nose section of vehicle.
Reutter Hardtop repair / correction / restoration.
The hard top is an original Porsche hard top with a sun roof with heavily rusted hard top frame and rails. The hard top is not original to this car.

RinkerToys (Jim Rinker):

Complete paint preparation on the nose panel. \$2,400.00

Apply first color coat of Custom Ruby Red paint.

Sand hood to remove rock chips.

Prepare hood and front bumper for color coat.

Eurton Electric - Convert the electric sunroof motor to 12 volts. \$477.62

Aircraft Windshield - Duplicate the quarter windows. See Parts section.

Bruce Crawford - Repair and refinish the delaminated steering wheel. \$850.00

Sherms Plating - Chrome latches. See Parts Section.

Found additional hardtop metal trim pieces that are heavily rusted.
Need to be restored or have new ones fabricated. The pieces will be evaluated by Gretener Prototype Engineering for repair/fabrication.

Invoice No.: 1749

Page 2 of 2
Date: 26-May-2021

Waiting for appointment with Autos International for headliner and trim.

Travel expenses (food, lodging, transportation, parking, etc.) to various vendors. \$0.00

Recommendations and Technicians Notes

The hard top with the electric sun roof is in very bad shape with heavily rusted hard top frame and rails. It requires extensive repairs and restoration. Autos International will be doing the hardtop's headliner and interior trim.

Sub Totals

Parts	\$1,104.10
Sales Tax @ 9.25%	\$102.13
Labor	\$0.00
Sublet	\$3,727.62
Shipping	\$0.00
CA Environmental Fees	\$0.00

Total Amount **\$4,933.85**

Page 1 of 2
 Invoice No.: 1754
 Date: 14-June-2021
 1964 Porsche 356C Carrera 2 Cab
 VIN: 159548
 LIC: N/A

INVOICE

LABOR	Amount
See Sublet section.	\$0.00

PARTS

Item	Part Number	Qty	Price	Total	Shipping
2 Post Fuse Box, Rear Turn Buckles & Clothes Hooks	Stoddard	1	\$101.38	\$101.38	
Paint Materials: Undercoat, Semi-black Paint, Custom Red Lacquer, PPG medium and slow thinners (by special order)	Materials	1	\$524.72	\$524.72	

Sublet and Labor Charges	Total	Shipping
--------------------------	-------	----------

Body repair / correction on nose section of vehicle.
 Reutter Hardtop repair / correction / restoration.

RinkerToys (Jim Rinker):
 Complete all final preparations to paint the nose, bumper and hood of the vehicle. \$3,960.00
 Seal and apply paint.
 Sand and buff appropriately.
 Clean the front undercarriage for undercoat and paint.
 Apply undercoat and semi-black paint as needed.

Found additional hardtop metal trim pieces that are heavily rusted.
 Need to be restored or have new ones fabricated. The pieces will be evaluated by Gretener Prototype Engineering for repair/fabrication.

Waiting for appointment with Autos International for headliner and trim.

Travel expenses (food, lodging, transportation, parking, etc.) to various vendors.	\$0.00
--	--------

Invoice No.: 1754

Page 2 of 2
Date: 14-Jun-20221

Recommendations and Technicians Notes

The hard top with the electric sun roof is in very bad shape with heavily rusted hard top frame and rails. It requires extensive repairs and restoration. Autos International will be doing the hardtop's headliner and interior trim.

Sub Totals

Parts	\$626.10
Sales Tax @ 9.25%	\$57.91
Labor	\$0.00
Sublet	\$3,960.00
Shipping	\$0.00
CA Environmental Fees	\$0.00

Total Amount	\$4,644.01
---------------------	-------------------

Page 1 of 2
Invoice No.: 1759
Date: 30-June-2021
1964 Porsche 356C Carrera 2 Cab
VIN: 159548
LIC: N/A

INVOICE

LABOR	Amount
See Sublet section.	\$0.00

PARTS

Item	Part Number	Qty	Price	Total	Shipping
Shipping trim pieces to GPE with oversize box.	Freight	1	\$122.43	\$122.43	

Sublet and Labor Charges	Total	Shipping
--------------------------	-------	----------

Body repair / correction on nose section of vehicle.
Reutter Hardtop repair / correction / restoration.

RinkerToys (Jim Rinker):
Reinstall oil coolers and horns. \$2,760.00
Reinstall all connections and wiring.
Install headlights and turn indicators along with lower grills.
Re-glue and install hood seal/gasket.
Install sunroof motor and wiring harness in hard top.
Re-adjst rear lid and touch up paint.
Polish aluminum sunroof tracks.

Found additional hardtop metal trim pieces that are heavily rusted.
Need to be restored or have new ones fabricated. The pieces will be evaluated by Gretener Prototype Engineering for repair/fabrication.
Send interior trim parts to Urs for evaluation.

Urs Gretener determined the best approach is to fabricate new pieces.

Waiting for appointment with Autos International for headliner and trim.

Travel expenses (food, lodging, transportation, parking, etc.) to various vendors.	\$0.00
--	--------

Invoice No.: 1759

Page 2 of 2
Date: 30-Jun-20221

Recommendations and Technicians Notes

The hard top with the electric sun roof is in very bad shape with heavily rusted hard top frame and rails. It requires extensive repairs and restoration. Autos International will be doing the hardtop's headliner and interior trim.

Sub Totals

Parts	\$122.43
Sales Tax @ 9.25%	\$11.32
Labor	\$0.00
Sublet	\$2,760.00
Shipping	\$0.00
CA Environmental Fees	\$0.00

Total Amount	\$2,893.75
---------------------	-------------------

Page 1 of 2
Invoice No.: 1782
Date: 1-Oct-2021
1964 Porsche 356C Carrera 2 Cab
VIN: 159548
LIC: N/A

INVOICE

LABOR

Amount

See Sublet section.

\$0.00

PARTS

Item	Part Number	Qty	Price	Total	Shipping
Sheet Steel, 20 gauge	Sheet Steel	1	\$62.00	\$62.00	
Shipping trim pieces to Jim Rinker with oversize box.	Freight	1	\$236.00	\$236.00	

Sublet and Labor Charges

Total Shipping

Body repair / correction on nose section of vehicle.
Reutter Hardtop repair / correction / restoration.

Gretener Prototype Engineering:

Porsche Carrera 2 Cabriolet Hardtop Trim Kit

Fabricated left and right side trim kit for hardtop
per received sample.

\$3,408.00

Fabricated left and right inner soft top side covers
per received sample.

Package and ship finished pieces to Jim Rinker.

Auto International will trim the pieces.

Travel expenses - Food, lodging, transportation, parking, etc. to vendors.

\$0.00

Recommendations and Technicians Notes

The hard top with the electric sun roof is in very bad shape with heavily rusted
hard top frame and rails. It requires extensive repairs and restoration.

Autos International will be doing the hardtop's headliner and interior trim.

Invoice No.: 1782

Page 2 of 2
Date: 1-Oct-2021

Sub Totals

Parts	\$298.00
Sales Tax @ 9.375%	\$27.94
Labor	\$0.00
Sublet	\$3,408.00
Shipping	\$0.00
CA Environmental Fees	\$0.00

Total Amount	\$3,733.94
---------------------	-------------------

Page 1 of 2
 Invoice No.: 1791
 Date: 22-Oct-2021
 1964 Porsche 356C Carrera 2 Cab
 VIN: 159548
 LIC: N/A

INVOICE

LABOR

Amount

See Sublet section.

\$0.00

PARTS

Item	Part Number	Qty	Price	Total	Shipping
Stoddard - Hood Handle, Top Seal, Paint Badge, Glass Molding Connectors		1	\$338.76	\$338.76	
Glass Seals - International Mercantile		1	\$393.00	\$393.00	
German Bumper Decos - Porsche San Diego		1	\$471.78	\$471.78	
Sunroof Switch - Used		1	\$500.00	\$500.00	
Fabricate Sunroof, Switch & Motor Wiring		1	\$420.00	\$420.00	
Headliner - Auto International		1	\$536.08	\$536.08	

Sublet and Labor Charges

Total

Shipping

Body repair / correction on nose section of vehicle.
 Reutter Hardtop repair / correction / restoration.

RinkerToys (Jim Rinker):

After final paint detail and assembly of bumper with German deco strips,
 mounting of hood and front bumper is complete.

\$3,360.00

Install replacement hood handle.

Deliver vehicle with hard top to Autos International for adjustment of rear
 carpet and headliner.

Create and install point to point wiring for sunroof switch and motor.

Clean and lubricate sliding roof cables and tracks.

Travel expenses (food, lodging, transportation, parking, etc.) to vendors.

\$0.00

Recommendations and Technicians Notes

The hard top with the electric sun roof is in very bad shape with heavily rusted
 hard top frame and rails. It requires extensive repairs and restoration.
 Autos International will be doing the hardtop's headliner and interior trim.

Invoice No.: 1791

Page 2 of 2
Date: 22-Oct-2021

Sub Totals

Parts	\$2,659.62
Sales Tax @ 9.375%	\$249.34
Labor	\$0.00
Sublet	\$3,360.00
Shipping	\$0.00
CA Environmental Fees	\$0.00

Total Amount	\$6,268.96
---------------------	-------------------

Page 1 of 2
Invoice No.: 1796
Date: 12-Nov-2021
1964 Porsche 356C Carrera 2 Cab
VIN: 159548
LIC: N/A

INVOICE

LABOR				Amount	
See Sublet section.				\$0.00	
PARTS					
Item	Part Number	Qty	Price	Total	Shipping
Sunroof Seal - Fabricate	Fabricate	1	\$100.00	\$100.00	
Sublet and Labor Charges				Total	Shipping
Body repair / correction on nose section of vehicle. Reutter Hardtop repair / correction / restoration.					
RinkerToys (Jim Rinker): Disassemble sunroof gear box cleaning. Lubricate sunroof gear box and perform clutch disc adjustment. Desing, fabricate and install sunroof seal. Make adjustments for fitment of interior trim pieces. Install rubber seals, latches, rear glass quarter windows and base seal with molding.				\$3,260.00	
Auto International: installation and adjustment of hard top headliner, interior trim pieces and rear carpet repair.				\$1,000.00	
The vehicle will be brought back to Gretener Prototype Engineering to finalize some interior metal trim pieces and then sent to Autos International to trim with leather.					
Travel expenses (food, lodging, transportation, parking, etc.) to various vendors.				\$0.00	

Invoice No.: 1796

Page 2 of 2
Date: 12-Nov-2021

Recommendations and Technicians Notes

N/A

Sub Totals

Parts	\$100.00
Sales Tax @ 9.375%	\$9.38
Labor	\$0.00
Sublet	\$4,260.00
Shipping	\$0.00
CA Environmental Fees	\$0.00

Total Amount	\$4,369.38
---------------------	-------------------

Page 1 of 2
 Invoice No.: 1965
 Date: 7-Aug-2023
 1964 Porsche 356C Carrera 2 Cab
 VIN: 159548
 LIC: N/A

INVOICE

LABOR

Amount

See Sublet section.

\$0.00

PARTS

Item	Part Number	Qty	Price	Total	Shipping
Main Jet - Weber IDF	73.401.135	4	\$5.15	\$20.60	
Main Jet - Weber IDF	73.401.140	4	\$5.15	\$20.60	
Solid Pump Diaphragm - Red	47.407.207	4	\$9.38	\$37.52	
Brake Fluid	ATE	2	\$8.95	\$17.90	
Pengrade 20W50 Engine Oil	BP20W50	8.5	\$16.95	\$144.08	
Original 1963 Porsche 356C Drivers Manual		1	\$269.00	\$269.00	
Freight	Freight	1	\$3.92	\$3.92	
356 Original Reutter Leather Key Fob		1	\$25.00	\$25.00	
19mm Aluminum Soft Lug Nut Socket		1	\$47.00	\$47.00	
356 Reutter Certificate of Delivery		1	\$20.00	\$20.00	
Porsche Shop Tower - Pack of 5		1	\$34.00	\$34.00	
Freight	Freight	1	\$54.00	\$54.00	

Sublet and Labor Charges

Total Shipping

Vehicle does not run well under acceleration.
 Inspect vehicle and perform a service.

Great Marques:

Change engine oil and clean oil filter.

\$800.00

Inspect brakes & flush brake fluid.

Check lights - ok.

Set tire pressures to spec.

No power under acceleration - Carburetion problem.

Replace the accelerator pump diaphragms.

The vehicle drove marginally better, but still not right under acceleration.

Replaced the 130 main jets with 135 main jets.

The vehicle drove much better under acceleration.

Invoice No.: 1965

Page 2 of 2
Date: 7-Aug-2023

Environmental Charges	\$8.50
-----------------------	--------

Travel expenses - (food, lodging, transportation, parking, etc.) to vendors.	\$0.00
--	--------

Recommendations and Technicians Notes

Recommend trying the 140 size main jets.

Sub Totals

Parts	\$693.62
-------	----------

Sales Tax	\$65.03
-----------	---------

Labor	\$0.00
-------	--------

Sublet	\$808.50
--------	----------

Shipping	\$0.00
----------	--------

Total Amount	\$1,567.15
---------------------	-------------------