



PORSCHE

Certificate of Authenticity

The Porsche vehicle with the identification number listed below was manufactured with the following assembly specifications:

9113301032

Model Year/Type

1973 911 S Coupe

Production Completion Date

04/12/1973

**Manufacturer's Suggested
Retail Price (MSRP)**

Information Not Available

Engine Number/Type

6331585

Transmission Number/Type

338172

Exterior Paint Color/Code

Silver Metallic/8080

Interior Material Color/Type

Black Leather/66

Optional Equipment

Cast Wheel 'Cup' Design 16 Inch
Leather Sport Seats Left/Right
Tinted Windshield and Side Glass
Sunroof
Michelin Tires

Peter Schwarzenbauer
President and Chief Executive Officer
Porsche Cars North America, Inc.

Dear Porsche Owner:

They say that racing improves the breed. That if a car can endure and overcome under the tremendous stresses and demands imposed on it at the racetrack, it can also perform admirably on the street.

The same could be said about mechanics. A mechanic used to working on race cars — with all the demands for speed, competence, cleanliness, and accuracy — can more than handle the challenges presented by a road car.


That's why you should visit Rick Moe's **Nuerburgring** Independent Porsche Service. Rick has had his hands on numerous racing Porsches: 906's, 908's, 904's, 911R's and RSR's, and 914 and 356 E Production cars. Also, he served as Chief Mechanic on Bill Yates' personal 911R, which was originally a factory car at LeMans.

Your Porsche has been tested and proven at the race-track. Put it in the hands of a man who's also been tested and approved at the track.

NUERBURGRING

5241 Shoreline Blvd., Mound, MN 55364, 472-6299

356 356A 356B 356C 901 904 906 908 910 911 917 930 935 936 915 924 928 911T 911E 911S 911L 914 914-6 916 914-2 917KL

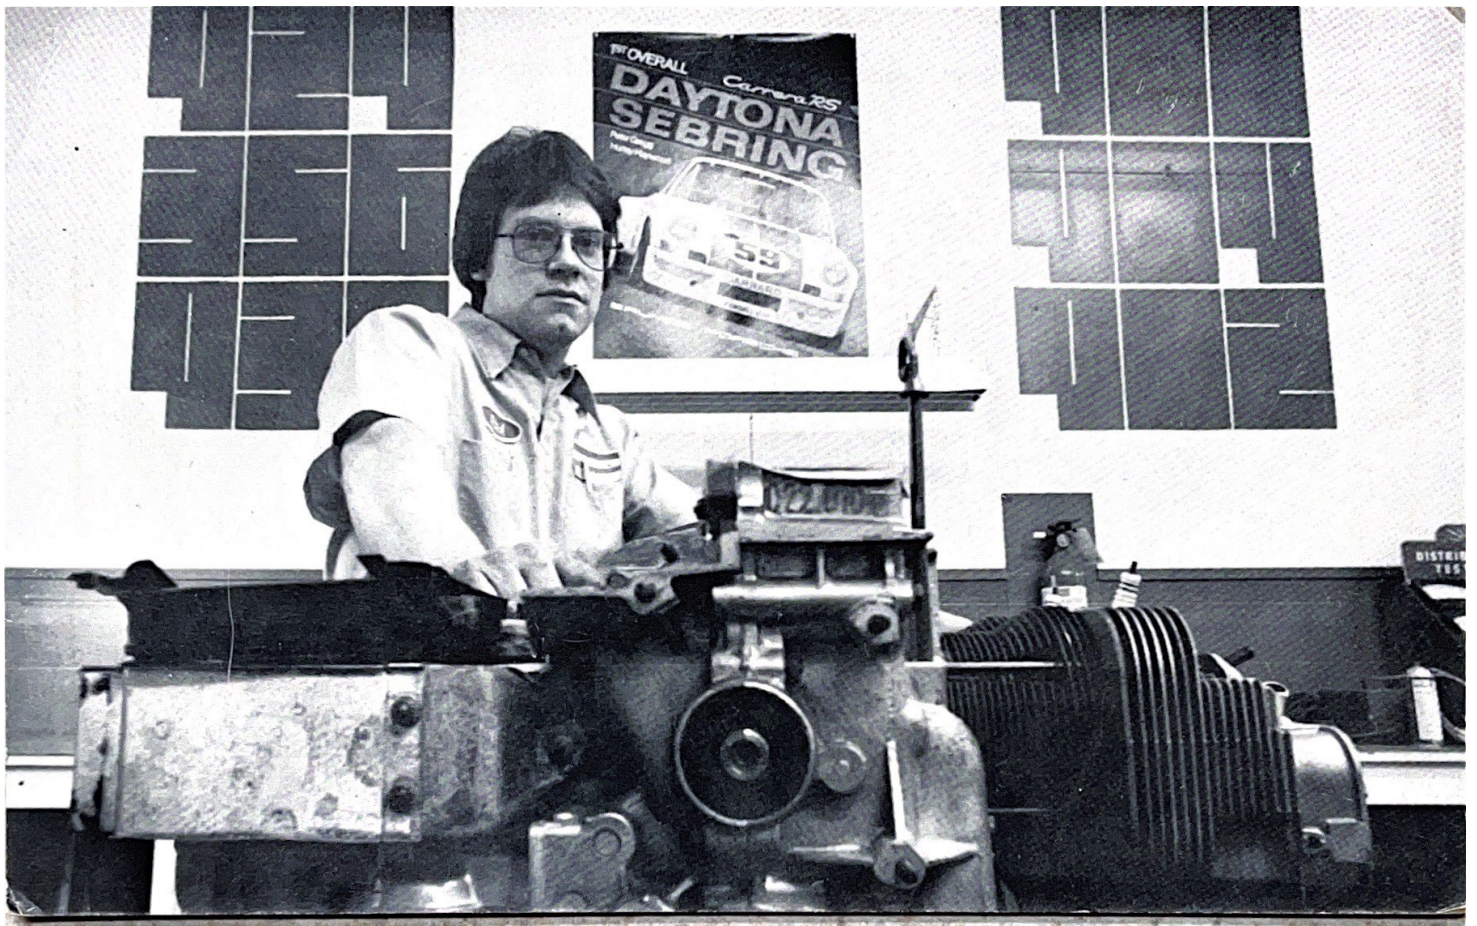

Dear Porsche Owner:

They say that racing improves the breed. That if a car can endure and overcome under the tremendous stresses and demands imposed on it at the racetrack, it can also perform admirably on the street.

The same could be said about mechanics. A mechanic used to working on race cars — with all the demands for speed, competence, cleanliness, and accuracy — can more than handle the challenges presented by a road car.

That's why you should visit Rick Moe's **Nuerburgring** Independent Porsche Service. Rick has had his hands on numerous racing Porsches: 906's, 908's, 904's, 911R's and RSR's, and 914 and 356 E Production cars. Also, he served as Chief Mechanic on Bill Yates' personal 911R, which was originally a factory car at LeMans.

Your Porsche has been tested and proven at the race-track. Put it in the hands of a man who's also been tested and approved at the track.

NUERBURGRING

5241 Shoreline Blvd., Mound, MN 55364, 472-6299

356 356A 356B 356C 901 904 906 908 910 911 917 930 935 936 915 924 928 911T 911E 911S 911L 914 914S 916 914Z 917KL



NUERBURGRING

INDEPENDENT PORSCHE SERVICE

5241 SHORELINE BLVD. (CO. RD. 15)

(BEHIND CHAMPION AUTO)

472-6299

MOUND, MINN. 55364

RICK MOE

MECHANIC

[illegible]

TERMS: CASH UNLESS ARRANGEMENTS MADE

TOTAL PARTS

I hereby authorize the repair work to be done with necessary materials. You and your employees may operate above vehicle for purpose of testing, inspection or delivery at my risk. An express mechanic's lien is acknowledged on vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles contained therein. I warrant that I am the owner of the vehicle and I am not under any obligation of disclosure of this document to any other person or entity. I understand that I am releasing you from all liability for any accident or any other cause beyond your control.

Any warranties on the products sold hereby are those of the manufacturer. As between this retail seller and buyer, the products to be sold "AS IS" and the entire risk as to the quality and performance of the product is with the buyer. The seller makes no express or implied warranties, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products. This disclaimer by this seller in no way affects the terms of the manufacturer's warranty. The buyer acknowledges being so informed prior to the sale.

✕

THE

NUERBURGRING

INDEPENDENT PORSCHE SERVICE

5241 SHORELINE BLVD. (CO. RD. 15)

472-6299

MOUND, MINN. 55364

RICK MOE

MECHANIC

[illegible][illegible]

TERMS: CASH UNLESS ARRANGEMENTS MADE

2

T H A Z Y Y O U



THE
NURBURGRING

INDEPENDENT PORSCHE SERVICE INC.

(612) 473-0500

482 TAMARACK AVENUE

LONG LAKE, MINN. 55356

RICK MOE

MECHANIC

266

W.I.L.	C.	QTY.	PART NO. OR DESCRIPTION	LIST	SALE AMOUNT
		6	Hydraulic bolts		35.00
		1	Pressure plate		162.95
		1	Clutch disc		139.85
		1	Thrust bearing		59.95
		1	Clutch kit		14.85
		2	Intake Brackets		16.50
		1	Bearing # 8		59.95
		12	ROD NUTS		16.80
		12	VALVE GUIDES		71.40
		2	TIMING CHAINS		56.90
		4	OIL RETURN LINES		18.00
		1	MAIN BEARING SET		69.85
		12	ROD BOLTS		83.40
		2	Intake Silencer Rings		16.50
		2	CAM SPEAKERS		85.90
		1	Pilot Bearing		8.50
		1	DISTRO RING SET		127.55
		6	Intake valves		77.70
		6	Exhaust valves		203.70
		12	Valve adjust screws		85.20
		12	CAM KEYS		398.20
		12	ROCKE SHAFTS		184.80
		1	Spacer SET		139.75
		1	Oil Filter		11.80
		2	CRASH AIR HOSES		11.90
		13	Oil Tensioner Oil		21.45
		1	Throttle cable		8.30
		6	SAROK BUSHES		9.90
		1	Pinch wire SET		43.95
		1	Oil Filter		52.10
		1	Cam Adjust		15.75
		9	Cam Springs		79.00
		8	Cam Followers		25.00
		8	Cam Adjusters		60.00
		8	Cam Followers		50.00
			TOTAL PARTS		

CUSTOMER'S NAME		ADDRESS		CITY		STATE		ZIP	
123456789		123456789		123456789		123456789		123456789	
YEAR	TYPE OR MODEL	MAKE	LICENSE NO.	SERIAL NO.	SPEEDOMETER				
1984	911	Porsche	123456789	123456789	123456789				
MOTOR NO.						OPER. NO.			
123456789						123456789			

REPAIR ORDER - LABOR INSTRUCTIONS	
1. Check oil level and change if necessary.	
2. Replace oil filter and drain oil.	
3. Replace spark plugs and wires.	
4. Replace timing belt and tensioner.	
5. Replace water pump and belts.	
6. Replace brake pads and rotors.	
7. Replace front suspension components.	
8. Replace rear suspension components.	
9. Replace steering knuckle and ball joints.	
10. Replace brake master cylinder and booster.	
11. Replace brake slave cylinder.	
12. Replace brake lines and hoses.	
13. Replace brake fluid.	
14. Replace brake pads and rotors.	
15. Replace brake master cylinder and booster.	
16. Replace brake slave cylinder.	
17. Replace brake lines and hoses.	
18. Replace brake fluid.	
19. Replace brake pads and rotors.	
20. Replace brake master cylinder and booster.	
21. Replace brake slave cylinder.	
22. Replace brake lines and hoses.	
23. Replace brake fluid.	
24. Replace brake pads and rotors.	
25. Replace brake master cylinder and booster.	
26. Replace brake slave cylinder.	
27. Replace brake lines and hoses.	
28. Replace brake fluid.	
29. Replace brake pads and rotors.	
30. Replace brake master cylinder and booster.	
31. Replace brake slave cylinder.	
32. Replace brake lines and hoses.	
33. Replace brake fluid.	
34. Replace brake pads and rotors.	
35. Replace brake master cylinder and booster.	
36. Replace brake slave cylinder.	
37. Replace brake lines and hoses.	
38. Replace brake fluid.	
39. Replace brake pads and rotors.	
40. Replace brake master cylinder and booster.	
41. Replace brake slave cylinder.	
42. Replace brake lines and hoses.	
43. Replace brake fluid.	
44. Replace brake pads and rotors.	
45. Replace brake master cylinder and booster.	
46. Replace brake slave cylinder.	
47. Replace brake lines and hoses.	
48. Replace brake fluid.	
49. Replace brake pads and rotors.	
50. Replace brake master cylinder and booster.	
51. Replace brake slave cylinder.	
52. Replace brake lines and hoses.	
53. Replace brake fluid.	
54. Replace brake pads and rotors.	
55. Replace brake master cylinder and booster.	
56. Replace brake slave cylinder.	
57. Replace brake lines and hoses.	
58. Replace brake fluid.	
59. Replace brake pads and rotors.	
60. Replace brake master cylinder and booster.	
61. Replace brake slave cylinder.	
62. Replace brake lines and hoses.	
63. Replace brake fluid.	
64. Replace brake pads and rotors.	
65. Replace brake master cylinder and booster.	
66. Replace brake slave cylinder.	
67. Replace brake lines and hoses.	
68. Replace brake fluid.	
69. Replace brake pads and rotors.	
70. Replace brake master cylinder and booster.	
71. Replace brake slave cylinder.	
72. Replace brake lines and hoses.	
73. Replace brake fluid.	
74. Replace brake pads and rotors.	
75. Replace brake master cylinder and booster.	
76. Replace brake slave cylinder.	
77. Replace brake lines and hoses.	
78. Replace brake fluid.	
79. Replace brake pads and rotors.	
80. Replace brake master cylinder and booster.	
81. Replace brake slave cylinder.	
82. Replace brake lines and hoses.	
83. Replace brake fluid.	
84. Replace brake pads and rotors.	
85. Replace brake master cylinder and booster.	
86. Replace brake slave cylinder.	
87. Replace brake lines and hoses.	
88. Replace brake fluid.	
89. Replace brake pads and rotors.	
90. Replace brake master cylinder and booster.	
91. Replace brake slave cylinder.	
92. Replace brake lines and hoses.	
93. Replace brake fluid.	
94. Replace brake pads and rotors.	
95. Replace brake master cylinder and booster.	
96. Replace brake slave cylinder.	
97. Replace brake lines and hoses.	
98. Replace brake fluid.	
99. Replace brake pads and rotors.	
100. Replace brake master cylinder and booster.	

I hereby authorize the repair work to be done with necessary materials. You and your employees may operate above vehicle for purpose of testing, inspection or delivery at my risk. An express mechanic's lien is acknowledged on vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicles in case of fire, theft, accident or any other cause beyond your control.	
Any warranties on the products sold hereby are those of the manufacturer. As between this retail seller and buyer, the product is to be sold "AS IS" and the entire risk as to the quality and performance of the product is with the buyer. The seller expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products. This disclaimer by this seller in no way affects the terms of the manufacturer's warranty. The buyer acknowledges being so informed prior to the sale.	
X TERMS CASH UNLESS ARRANGEMENTS MADE	
TOTAL	

THANK YOU



NURBURGRING

INDEPENDENT PORSCHE SERVICE INC.

RICK MOE

482 TAMARACK AVENUE

(612) 473-0500

LONG LAKE, MINN. 55356

MECHANIC

[illegible]

I hereby authorize the repair work to be done with necessary materials. You and your employees may operate above vehicle for purpose of testing, inspection or delivery at my expense. An express mechanic's lien is acknowledged on vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicles in case of fire, theft, accident or any other cause beyond your control.

Any warranties on the products sold hereby are those of the manufacturer. As between this retail seller and buyer, the product is to be sold "AS IS", and the entire risk as to the quality and performance of the product is with the buyer. The seller expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for any particular use, and the buyer agrees to accept the product as sold. No other person to assume for any liability in connection with the sale of said products. This disclaimer by this seller in no way affects the terms of the manufacturer's warranty. The buyer acknowledges being so informed prior to the sale.


TERMS: CASH UNLESS ARRANGEMENTS MADE

TOTAL PARTS

Palace

T H A Z Y Y O U

PARTS

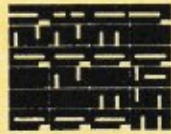[illegible]

THE NURBURGRING
Independent Porsche Service Inc.

1625 5th Street South
Hopkins Minnesota 55343

NAME

ADDRESS

YR.

MODEL

LICENSE NO.

MILEAGE

CHASSIS NO.

1

ENGINE NO.

DATE _____

PHONE—HOME

PHONE—WORK

25

LABOR

I hereby authorize the repair work to be done with necessary materials. You and your employees may operate above vehicles for purpose of testing, inspection or delivery at my risk. An express mechanic's lien is acknowledged on vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicles in case of fire, theft, accident or any other cause beyond your control.

Any warranties on the products sold hereby are those of the manufacturer. As between this retailer and buyer, the product is to be sold "AS IS" and the entire risk as to the quality and performance of the product is with the buyer. The seller expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products. The disclaimer by this seller in no way affects the terms of the manufacturer's warranty. The buyer acknowledges being so informed prior to the sale.

✕

TOTAL

TERMS: CASH UNLESS ARRANGEMENTS MADE

TOTAL

4168 20

NURBURGRING, INC.

FOR DR. JAMES PRIEST

1625 FIFTH STREET SOUTH

HOPKINS, MINNESOTA 55343
(612)931-1176 7/25/89 INVOICE

474-5850 944-2519
MAKE PORSCHE MODEL 911 YEAR 73
MILES 4783 LICENSE DQM 964 BY RM

--SHOP LABOR DESCRIPTION-----TECH-----AMOUNT--

TUNE UP/ADJUST VALVES CHECK MM 270.00

CYLINDER LEAKDOWN REPLACE SPARK

PLUGS POINTS AND FUEL FILTER ADJUST

DWELL AND TIMING CHANGE VALVE COVER

GASKETS CHECK AND ADJUST BASIC FUEL

INJECTION SETTINGS CLEAN ENGINE

COMPARTMENT AND TEST DRIVE.

CHANGE OIL AND FILTER LUBE CHASSIS

CHECK ALL FLUID LEVELS CHECK TIRES

CYLINDER LEAKDOWN:

1.14% 2.12% 3.24% 4.22% 5.22% 6.22%

FLUSH AND BLEED BRAKE SYSTEM MM 27.00

INSTALL REAR BRAKE PADS MM 45.00

REPLACE FRONT BRAKE PADS MM 45.00

CHANGE TRANSMISSION FLUID MM 22.50

...USE KENDALL 80W90 FLUID

CHECK OPERATION OF LEFT WINDOW

ADJUST TENSION ON HAND TROTTLE LEVER

CHECK OPERATION OF TACHOMETER

CHECK ELECTRICAL DRAW-REMOVE FUSE

FROM TELEPHONE SYSTEM

CHECK FOR STARTER DRAW-REPLACE

STARTER.

REMOVE AND CLEAN FRONT BRAKE HOSES

REPLACE LEFT REAR BRAKE HOSE

REPLACE THERMOSTAT GASKET

TEST AND REPLACE IGNITION WIRES AS

NEEDED LABOR CHARGE FOR ABOVE

SERVICES MM 45.00

-----PARTS-----

QTY	PART NUMBER	NAME OF PART	PRICE
6	WR5DP4	SPARK PLUG	18.90
1	930 105 195 03	VALVE COVER GSKT. SET	14.95
11	473-21202	OIL 20W50 KENDAL GT-1	21.45
1	PC207 Di 260	OIL FILTER	7.95
1	901 110 909 00	FUEL FILTER MFI	32.95
1	911 602 936 00	IGNITION POINT SET	5.35
2	330502024	CASTROL LMA BRAKE FLUID 12 OZ.	7.50
1	D141T	BRAKE PADS	14.72
6	473-61604	KENDALL GEAR LUBE 80W90	9.00
1	D195T	FRONT BRAKE PAD/ALLOY CALIPER	41.87
1	901 355 631 01	BRAKE LINE	11.95
1	999 107 053 40	THERM. "O" RING	1.95
1	SR68X	REBUILT STARTER	230.00
1	900 612 001 00	IGNITION CABLE per meter	7.30

NURBURGRING, INC.

FOR DR. JAMES PRIEST

1625 FIFTH STREET SOUTH

HOPKINS, MINNESOTA 55343
(612)931-1176 7/25/89 INVOICE

474-5850 944-2519
MAKE PORSCHE MODEL 911 YEAR 73
MILES 4783 LICENSE DQM 964 BY RM

SERVICE FOR YOUR PORSCHE
AS IT WAS INTENDED



PARTS TOTAL	425.84
LABOR TOTAL	454.50
OTHER CHARGES	.00
SALES TAX	25.55
PD IN ADVANCE	.00
PAID BANKCARD	905.89

NURBURGRING, INC.

1625 FIFTH STREET SOUTH

HOPKINS, MINNESOTA 55343

(612)931-1176 9/04/92 INVOICE

FOR DR. JAMES PRIEST

24020 YELLOWSTONE TRAIL

SHOREWOOD

MN 55331

474-5850

944-2519

MAKE PORSCHE MODEL 911 YEAR 73

214 MILES 110394 LICENSE DQM 964 BY WS

---SHOP LABOR DESCRIPTION-----TECH-----AMOUNT---

MINOR ENGINE TUNE. REPLACE SPARK	WS	216.00
PLUGS POINTS AND FUEL FILTER ADJUST		
DWELL AND TIMING.		
CHECK AND ADJUST BASIC FUEL		
INJECTION SETTINGS CLEAN ENGINE		
COMPARTMENT AND TEST DRIVE.		
CHANGE OIL AND FILTER LUBE CHASSIS		
CHECK ALL FLUID LEVELS CHECK TIRES		
WASTE OIL DISPOSAL FEE	WS	1.54
OIL LEAKS FROM OIL TANK, OIL TANK		
RETURN LINE, CRANK PULLEY SEAL, ECT.		
REPAIR BATTERY GROUND CABLE.	WS	54.00
CLEAN ENGINE COMPARTMENT.	WS	54.00
LUBRICATE LEFT WINDOW CHANNEL.		
POWER FLUSH AND BLEED BRAKE SYSTEM	WS	54.00
REMOVE AND CLEAN OIL TANK TO	WS	
INSPECT FOR OIL LEAK. REINSTALL.	WS	162.00
TIGHTENED HAND THROTTLE LEVER.		
ADJUST FRONT WHEEL BEARINGS.		

-----PARTS-----

QTY	PART NUMBER	NAME OF PART	PRICE
6	WR5DP4	SPARK PLUG-PLATINUM-WR5DP	19.44
9	527-7138	OIL 20W50 KENDAL GT-1	23.67
1	901 110 909 00	FUEL FILTER-MFI 010	16.10
1	901 108 955 11	AIR FILTER CARB/MFI	18.00
1	1 237 013 139	IGNITION POINT SET	6.07
1	930 107 764 00	OIL FILTER-911 72> PC260	10.95
2	330502024	CASTROL LMA BRAKE FLUID 12 OZ.	7.00
1	914 201 891 00	TANK GASKET	2.00
1	NPN/5	SHOP SUPPLYS	5.00
1	9.5X710	V BELT 9.5X710	5.65

SERVICE FOR YOUR PORSCHE (R)

AS IT WAS INTENDED

THANKYOU

PARTS TOTAL	113.88
LABOR TOTAL	541.54
OTHER CHARGES	.00
SALES TAX	7.40
PD IN ADVANCE	.00
PAID BANKCARD	662.82

NURBURGRING, INC.

1625 FIFTH STREET SOUTH

HOPKINS, MINNESOTA 55343

(612)931-1176 7/16/93 INVOICE

FOR DR. JAMES PRIEST

24020 YELLOWSTONE TRAIL

SHOREWOOD

MN 55331

474-5850

944-2519

MAKE PORSCHE MODEL 911 YEAR 73

224 MILES 113246 LICENSE 021 HCL BY SS

--SHOP LABOR DESCRIPTION-----TECH-----AMOUNT--

CHECK OIL LEAKS, SERIOUS? NO.

CHANGE OIL AND FILTER

RM

54.00

LUBE CHASSIS

CHECK ALL FLUID LEVELS

AIR TIRES/CHECK CONDITION

GENERAL CHECK OVER

WASTE OIL DISPOSAL FEE

RM

2.75

CHECK SUNROOF OPERATION, BINDS WHEN

OPENING/CLOSING, WAS REMOVED BY

BODYSHOP, NOW DOES NOT WORK RIGHT,

CAN IT BE ADJUSTED??

WOULD NEED TO REMOVE SUNROOF,

DISASSEMBLE, CLEAN AND READJUST.

CHECK LIGHTING SYSTEM. OK.

OIL LEVEL INOP.

WINDSHIELD WASHER PUMP INOP.

REPAIR ANTENNA/BROKEN

RM

27.00



-----PARTS-----

QTY PART NUMBER

NAME OF PART

PRICE

11 20W50

OIL 20W50 KENDAL GT-1

24.75

1 PC260

OIL FILTER-911 72> PC260

9.95

2 930 101 391 00

STRAINER GASKET 911

1.20

2 900 123 011 20

DRAIN PLUG SEAL-911/944

.80

1 AN-300

ANTENNA-MANUAL CHROME

13.91

SERVICE FOR YOUR PORSCHE (R)

AS IT WAS INTENDED

THANKYOU

PARTS TOTAL

50.61

LABOR TOTAL

83.75

OTHER CHARGES

.00

SALES TAX

3.29

PD IN ADVANCE

.00

PAID BANKCARD

137.65

NURBURGRING, INC.

1625 FIFTH STREET SOUTH

HOPKINS, MINNESOTA 55343

(612)931-1176 6/13/94 INVOICE

FOR DR. JAMES & ERIC PRIEST

24020 YELLOWSTONE TRAIL

SHOREWOOD MN 55331

474-5850 944-2519

MAKE PORSCHE MODEL 911 YEAR 73

155 MILES 116023 LICENSE 021 HCL BY SS

--SHOP LABOR DESCRIPTION-----TECH-----AMOUNT--

CHANGE OIL AND FILTER (SYNTHETIC) WS 57.00

LUBE CHASSIS

CHECK ALL FLUID LEVELS

AIR TIRES/CHECK CONDITION

GENERAL CHECK OVER

CHECK BRAKE SQUEEK/LOUD

POWER FLUSH AND BLEED BRAKE SYSTEM WS 57.00

CHECKED BRAKES/PADS/ETC. - OKAY.

CHECK TAIL LITE INOP (LEFT REAR)

REPLACED TAIL LITE ASSEMBLY WS 28.50

REPLACE FRONT STRUT INSERTS WS 171.00

REPLACE REAR SHOCKS WS 57.00

LOWERED FRONT RIDE HEIGHT/TOO HIGH WS

REPLACED WIPER BLADES WS

*****NOTE*****

RECOMMEND TURBO TIE RODS FOR SLOPPY STEERING.

NEEDS A FOUR WHEEL ALIGNMENT

--OTHER CHARGES DESCRIPTION-----CODE-----AMOUNT--

HAZARDOUS WASTE RECYCLING FEE H 2.25

-----PARTS-----

QTY	PART NUMBER	NAME OF PART	PRICE
1	PC260	OIL FILTER 72>911 PC260	9.95
2	930 101 391 00	STRAINER GASKET 911	1.30
2	900 123 011 20	DRAIN PLUG SEAL-911/944	.30
11	MAXOIL 20W50	MAXOIL 20W50 SYNTHETIC	58.30
2	82-1756	REAR SHOCKS/KONI	260.40
2	86-1638	FRONT STRUT INSERTS/KONI	297.00
1	LMA	CASTROL LMA BRAKE FLUID 12 OZ.	3.15
1	1157	BULB/12V	.95
2	40 713	WIPER BLADE 13"	12.70
1	0 311 460 402	TAIL LITE ASSEMBLY/LEFT REAR	194.65

SERVICE FOR YOUR PORSCHE

AS IT WAS INTENDED.

****THANK YOU!!****

PARTS TOTAL 838.70

LABOR TOTAL 370.50

OTHER CHARGES 2.25

SALES TAX 54.52

PD IN ADVANCE .00

PAID BANKCARD 1265.97

AUTOPIA
2311 HENNEPIN AVE. SOUTH
MINNEAPOLIS, MN 55405
(612) 377-2886

Repair Order # 01241

Date Printed : 5/ 5/98

Page : 1

Center : 1

A NEW LEVEL OF CAR SERVICE YOU'VE ONLY DREAMED OF

Customer : PRIEST, JAMES

Address : 1769 DUPONT AVE SO

City : MINNEAPOLIS, MN 55403

Phone 1 : (612) 377-4625 Ext : ILKA

Phone 2 : (612) ----- Ext :

Vehicle : 1973 PORS 911 SERIES

License :

ProDate :

V.I.N. :

Engine : 6-2341 2.3L

Trans :

Mileage : 19793

Color : WHITE

Parts

Quan	Part Number	Description	Price
1.00	72116	OIL FILTER	0.00
1.00	OFI	OIL & FILTER INC	40.00
1.00	RECYCLE CHARGE	1.50	
1.00		SUPER TRIM ADHES:	16.99
1.00	P911-541-225-03	WINDSHIELD SEAL	95.94
1.00	P901-545-901-21	SSTO 91	80.82
1.00	P911-564-191-00	SUNROOF SEAL	41.22
1.00	P-911-564-193-00	SUNROOF SEAL	23.94
1.00	P901-564-905-05	SUNROOF SEAL	17.00
4.00	P644-555-515-00	GROMMET	5.76
1.00	P928-613-182-00	RAIL ADJUST	120.06
1.00	SHF	SHIPPING	15.00

Labor

On	Tech	Description	Time	Charge
MS	70	SUNROOF INOP & LEAKS		102.00
SU03	70	MACHINE SHOP CHARGES, R&R WINDSHIELD & REAR WINDOW , INSTALL NEW SEALS, REPLACE HEAD LINER (\$70.00 ADD'L FOR SEALS)		720.00
MI01	06	MECH INSPECTION ADVISE ON NEEDS		68.00
OF01	06	CHANGE OIL & FILTER, CHECK BELTS HOSES & FLUIDS & ADVISE ON NEEDS.		22.95
EL06	06	BATTERY, SECURE, REATTACH CHARCOAL CAN LABOR DISCOUNT		39.00 -19.49

PAID

OK Bad Recommendation OK Bad Recommendation OK Bad Recommendation

needs struts & front end aln

I hereby authorize the repair work to be done along with the necessary parts and materials and hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere, at your discretion, for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on the above vehicle to secure the amount of repairs thereto. I understand that dealer/owner is not responsible for delay or other consequence due to the unavailability of parts shipments beyond their control. Not responsible for damage or articles left in car in case of fire, theft or any other cause beyond our control.

WARRANTY IS 12 months OR 12000 MILES WHICH EVER OCCURS FIRST, UNLESS SPECIFIED OTHERWISE!

X

Labor : \$ 212.46

Parts : \$ 456.73

Sublet : \$ 720.00

Other Fees : \$ 1.50

SUPPLIES \$ 14.87

Subtotal : \$ 1,405.56

Sales Tax : \$ 33.01

Paid By : Total : \$ 1,438.57

Pay Ref : Paid : \$ 0.00

Due : \$ 1,438.57

AUTOPIA

2311 HENNEPIN AVE. SOUTH
MINNEAPOLIS, MN 55405
(612) 377-2886

A NEW LEVEL OF CAR SERVICE YOU'VE ONLY DREAMED OF

Repair Order # 05651

Date Printed : 4/29/99

Page : 1

Center : 3

Customer : PRIEST, JAMES

Address : 1769 DUPONT AVE SO

City : MINNEAPOLIS, MN 55403

Phone 1 : (612) 377-4625

Ext : ILKA

Phone 2 : (612) -----

Ext :

Vehicle : 1973 PORS 911 SERIES

License : 735666

ProD : 4-73

Vin : 9113301032

Engine : 6-2341 2.3L

Trans : STD

Mileage : 21776

Colo : WHITE

Parts

Quan	Part Number	Description	Price
1.00	OC4	OIL CHANGE	24.00
1.00	RECYCLE CHARGE	1.50	
1.00	72116	OIL FILTER	
4.00	10/30	MOBIL OIL	
1.00	04029	IGNITION ROTOR	40.50

Labor

Op Tech	Description	Time	Charge
TU 70	VEHICLE BACKFIRES ON DEACCELERATION, SCOPE CHECK, REPLACE DIST. ROTOR, ADJUST AND SYNC. THROTTLE LINKAGE & MECHANICAL INJECTION, SET TO SPECS AND ROAD TEST. NO FURTHER PROBLEMS NOTED		182.50
EL 70	CUSTOMER PUT IN THE BATTERY AFTER STORAGE, PLEASE INSTALL THE HOLD DOWN		0.00
			7.30
EL12 70	CHECK & ADVISE :THE HEADLAMP SYSTEM, WHEN CUSTOMER WOULD TURN ,THE HIGH ,LOW WOULD CUT OUT THE HEADLAMPS,CUSTOMER WOULD THEN WIGGLE SWITCH & LIGHTS WOULD COME BACK ON, NEEDS NEW SWITCH.		0.00
			0.00
OP05	SEATS: THE DRIVERS SEAT THE RECLINING POSITION WHEN CUSTOMER SITS DOWN WILL POP OUT OF PLACE. NEEDS SEAT PULLED OUT AND FURTHER INSPECTED, POSS. REBUILT		0.00
			0.00
PM01 70	CHANGE OIL AND FILTER, TOP OFF FLUIDS		40.95

PAID

OK Bad Recommendation OK Bad Recommendation OK Bad Recommendation

(Found Parts)

WILL NEED R/L BALL JOINT AND ALSO FRONT SHOCKS GETTING SPONGY.

I hereby authorize the repair work to be done along with the necessary parts and materials and hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere, at your discretion, for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on the above vehicle to secure the amount of repairs thereto. I understand that dealer/owner is not responsible for delay or other consequence due to the unavailability of parts shipments beyond their control. Not responsible for damage or articles left in car in case of fire, theft or any other cause beyond our control.

WARRANTY IS 12 months OR 12000 MILES WHICH EVER OCCURS FIRST, UNLESS SPECIFIED OTHERWISE!

X

Labor :	\$	196.14
Parts :	\$	64.50
Sublet :	\$	0.00
Other Fees :	\$	1.50
SUPPLIES :	\$	14.71
Subtotal :	\$	276.85
Sales Tax :	\$	5.54

Paid By :	Total :	\$	282.39
Pay Ref :	Paid :	\$	0.00
	Due :	\$	282.39

AUTOPIA

2311 HENNEPIN AVE. SOUTH
MINNEAPOLIS, MN 55405
(612) 377-2886

Repair Order # 05651

Date Printed : 4/29/99

Page : 2

Center : 3

LEVEL OF CAR SERVICE YOU'VE ONLY DREAMED OF

: PRIEST, JAMES

ss : 1769 DUPONT AVE SO

City : MINNEAPOLIS, MN 55403

Phone 1 : (612) 377-4625

Ext : ILKA

Phone 2 : (612) -----

Ext :

Vehicle : 1973 PORS 911 SERIES

License : 735666

ProD : 4-73

Vin : 9113301032

Engine : 6-2341 2.3L

Trans : STD

Mileage : 21776

Colo : WHITE

Parts**Labor**

Quan	Part Number	Description	Price	Op Tech	Description	Time	Charge
							0.00
				PM0:	70 SAFETY INSPECTION: 42 POINT INSPECTION & ADVISE ON NEEDS-N/C		0.00
				WT	CHECK CONDITION OF THE REAR TIRES NEEDS REAR TIRES SOON! LABOR DISCOUNT		0.00 -34.61

OK Bad Recommendation OK Bad Recommendation OK Bad Recommendation

WILL NEED R/L BALL JOINT AND ALSO FRONT SHOCKS GETTING SPONGY.

I hereby authorize the repair work to be done along with the necessary parts and materials and hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere, at your discretion, for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on the above vehicle to secure the amount of repairs thereto. I understand that dealer/owner is not responsible for delay or other consequence due to the unavailability of parts shipments beyond their control. Not responsible for damage or articles left in car in case of fire, theft or any other cause beyond our control.

WARRANTY IS 12 months OR 12000 MILES WHICH EVER OCCURS FIRST, UNLESS SPECIFIED OTHERWISE!

X _____

Labor : \$ 196.14

Parts : \$ 64.50

Sublet : \$ 0.00

Other Fees : \$ 1.50

SUPPLIES \$ 14.71

Subtotal : \$ 276.85

Sales Tax : \$ 5.54

Paid By : Total : \$ 282.39

Pay Ref : Paid : \$ 0.00

Due : \$ 282.39

AUTOPIA
2311 HENNEPIN AVE. SOUTH
MINNEAPOLIS, MN 55405
(612) 377-2886

Repair Order # **05762**

Date Printed : 5/13/99

Page : 1

Center : 3

A NEW LEVEL OF CAR SERVICE YOU'VE ONLY DREAMED OF

Customer : PRIEST, JAMES

Address : 1769 DUPONT AVE SO

City : MINNEAPOLIS, MN 55403

Phone 1 : (612) 377-4625 Ext : ILKA

Phone 2 : (612) ----- Ext :

Vehicle : 1973 PORS 911 SERIES

License : 735666

ProD : 4-73

Vin : 9113301032

Engine : 6-2341 2.3L

Trans : STD

Mileage : 21792

Colo : WHITE

Parts

Quan	Part Number	Description	Price
1.00	91161330130	SWITCH	283.90
1.00	91134104901	BALL JOINT	70.00
1.00	ENVIRONMENT CHG	4.50	

Labor

Op Tech	Description	Time	Charge
CS	70 REPLACE LOWER BALL JOINT		109.50
			0.00
EL	70 INSTALL TURN SIGNAL SWITCH		124.10
			0.00
TU	70 HARD TO START HOT, EXCESSIVE CRANKING ALSO STILL BACK FIRES CHECK FUEL PRESSURE, CAR IS RUNNING RICH, DECARBON AND SYNC AIR HORNS, CHECK FUEL DIST- RIBUTION, NO FURTHER PROBLEMS NOTED		328.50
70			0.00
NA	LABOR CREDIT FROM LAST RO		-182.50
	LABOR DISCOUNT		-56.94

PAID

OK Bad Recommendation OK Bad Recommendation OK Bad Recommendation

I hereby authorize the repair work to be done along with the necessary parts and materials and hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere, at your discretion, for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on the above vehicle to secure the amount of repairs thereto. I understand that dealer/owner is not responsible for delay or other consequence due to the unavailability of parts shipments beyond their control. Not responsible for damage or articles left in car in case of fire, theft or any other cause beyond our control.

WARRANTY IS 12 months OR 12000 MILES WHICH EVER OCCURS FIRST, UNLESS SPECIFIED OTHERWISE!

X

Labor : \$ 322.66

Parts : \$ 353.90

Sublet : \$ 0.00

Other Fees : \$ 4.50

SUPPLIES \$ 24.20

Subtotal : \$ 705.26

Sales Tax : \$ 26.47

Paid By : Total : \$ 731.73

Pay Ref : Paid : \$ 0.00

Due : \$ 731.73

AUTOPIA
2311 HENNEPIN AVE. SOUTH
MINNEAPOLIS, MN 55405
(612) 377-2886

Repair Order #0016311

Date Printed : 6/8/01

Page : 1

Center : 3

A NEW LEVEL OF CAR SERVICE YOU'VE ONLY DREAMED OF

Customer : PRIEST, JAMES

Address : 2100 JAMES AVE S

City : MINNEAPOLIS, MN 55403

Phone 1 : (612) 377-4625 **Ext :** ILKA

Phone 2 : (612) - **Ext :**

Vehicle : 1973 PORS 911 SERIES

License : 735666

ProD : 4-73

Vin : 9113301032

Engine : 6-2341 2.3L

Trans : STD

Mileage : 23426

Colo : WHITE

Parts

Quan	Part Number	Description	Price
2.00	91135290700/90800	REAR DISC CALIPERS	570.80
2.00		ENVIRONMENT CHG	4.50
1.00	91135295002	REAR DISC PADS	47.50
2.00	502E	BRAKE FLUID	11.98
2.00	TR1	MACINE ROTORS	60.00

Labor

Op Tech	Description	Time	Charge
BR 001 30	CHECK & ADVISE ON BRAKES:AFTER DRIVEN FOR AWHILE LOSES BRAKES & THE PEDAL GOES TO THE FLOOR,TEST DRIVEN COULD NOT DUPLICATE COMPALINT BRAKE SYSTEM CHECK FOUND THE LR CALIPER SEIZED.RECOMMEND REPLACING BOTH SIDES WITH A FLUID FLUSH. R&R BOTH REAR CALIPERS & PADS,CLEAN REAR DISC ROTORS.FLUSH THE BRAKE FLUID.		249.00
TU 004 70	RUNIBILITY PROBLEM:READJUST THE BASE MIXTURE & RPMS.CUSTOMER TO MONITOR.		0.00
LD 001 NA	JUNE LABOR DISCOUNT @:20 %		0.00
	LABOR DISCOUNT		-49.80

OK Bad Recommendation OK Bad Recommendation OK Bad Recommendation

PAID

I hereby authorize the repair work to be done along with the necessary parts and materials and hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere, at your discretion, for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on the above vehicle to secure the amount of repairs thereto. I understand that dealer/owner is not responsible for delay or other consequence due to the unavailability of parts shipments beyond their control. Not responsible for damage or articles left in car in case of fire, theft or any other cause beyond our control.

WARRANTY IS 12 months OR 12000 MILES WHICH EVER OCCURS FIRST, UNLESS SPECIFIED OTHERWISE!

X _____

Labor : \$199.20

Parts : \$690.28

Sublet : \$0.00

Other Fees : \$4.50

SUPPLIES \$14.94

Subtotal : \$908.92

Sales Tax : \$48.32

Paid By : **Total :** \$957.24

Pay Ref : **Paid :** \$0.00
 Due : \$957.24

NURBURGRING, INC.

5315 PIONEER CREEK DRIVE

MAPLE PLAIN, MINNESOTA

55359

763-479-6393

nurburg@isd.ne

JIM	PRIEST
XXX	
MINNEAPOLIS, MINNESOTA	
Home Phone	
Work Phone	

Date	6/6/2002	Invoice #	INV0000206
PORSCHE		911S	
9113301032		735-666	
Mileage	123428	Year	73

QUANTITY	SERVICE	SERVICE	PRICE	TOTAL
1	TUNE 911 70-73	TUNE UP/ADJUST VALVES		\$700.00
1	OIL 911 72-89	OIL AND FILTER SERVICE *CASTROL*		\$0.00
1	LABOR	INSTALL EXHAUST SYSTEM		\$200.00
1	LABOR	INSTALL HORNS		\$25.00
1	NO CHARGE	CHECK LIGHTS		\$0.00
1	NO CHARGE	FASTEN BATTERY		\$0.00
1	NO CHARGE	REPLACE WIPER ARMS AND BLADES		\$0.00
1	NO CHARGE	REMOVE AIR COND/ENGINE BAY		\$0.00

QUANTITY	PART NUMBER	PART DESCRIPTION	PRICE	TOTAL
1	901 108 955 11	AIR FILTER 911 '65-73 LX228	\$19.95	\$19.95
1	901 110 909 10	FUEL FILTER 911 MFI '69-73 PCG 110 909 10	\$55.95	\$55.95
1	930 105 195 03	VALVE COVER GASKET SET	\$18.95	\$18.95
1	901 602 502 00	IGNITION COIL 911 65-73	\$98.95	\$98.95
1	1.237.013.061	POINT SET 911 72-73	\$13.98	\$13.98
2	900 123 011 20	SEAL, OIL STRAINER 911 '65> 22X27mm	\$0.75	\$1.50
9	CASTROL 20W/50	CASTROL 20W/50	\$3.00	\$27.00
1	930 107 764 00	OIL FILTER 911 '72-89 C2/4 '89> OC54	\$7.98	\$7.98
1	993 635 205 99	HORN SET	\$48.95	\$48.95
1	914 628 313 10	WIPER ARM-LEFT	\$33.95	\$33.95

VISIT US AT:
www.the-nurburgring.com
Thankyou!

Labor:	\$925.00
Parts:	\$2,298.48
Other:	
Tax:	\$149.40
Total:	\$3,372.88
Amount Paid:	\$3,372.88
Balance Due:	\$0.00

NURBURGRING, INC.

5315 PIONEER CREEK DRIVE

MAPLE PLAIN, MINNESOTA

55359

763-479-6393

nurburg@isd.ne

JIM	PRIEST
XXX	
MINNEAPOLIS, MINNESOTA	
Home Phone	
Work Phone	

Date	6/6/2002	Invoice #	INV0000206
PORSCHE		911S	
9113301032		735-666	
Mileage	123428	Year	73

QUANTITY	SERVICE	SERVICE	PRICE	TOTAL
----------	---------	---------	-------	-------

QUANTITY	PART NUMBER	PART DESCRIPTION	PRICE	TOTAL
----------	-------------	------------------	-------	-------

1	914 628 313 10	WIPER ARM-RIGHT	\$33.95	\$33.95
2	40713	WIPER BLADE FRONT 13" BOSCH	\$14.98	\$29.96
1	911 211 274 00	BLOWER HOSE	\$12.95	\$12.95
1	901 201 271 00	OIL TANK CAP	\$14.95	\$14.95
1	911 211 522 00	AIR TUBE 60mmX1100mm	\$27.98	\$27.98
1	911 111 025 00	MUFFLER	\$299.98	\$299.98
2	SSI/MFI L/R	STAINLESS STEEL HEAT EXCHANGERS	\$589.98	\$1,179.96
6	WR3DPO	SPARK PLUGS	\$18.95	\$113.70
1	911 609 010 98	IGNITION WIRE SET	\$224.98	\$224.98
5	999 085 001 02	HEX NUT-911 HEAT EXCHANGER 8mm	\$1.35	\$6.75

VISIT US AT:

www.the-nurburgring.com

Thankyou!

Labor: \$925.00

Parts: \$2,298.48

Other:

Tax: \$149.40

Total: \$3,372.88

Amount Paid: \$3,372.88

Balance Due: \$0.00

NURBURGRING, INC.

5315 PIONEER CREEK DRIVE

MAPLE PLAIN, MINNESOTA

55359

763-479-6393

nurburg@isd.ne

JIM	PRIEST
XXX	
MINNEAPOLIS, MINNESOTA	
Home Phone	
Work Phone	

Date	6/6/2002	Invoice #	INV0000206
PORSCHE		911S	
9113301032		735-666	
Mileage	123428	Year	73

QUANTITY	SERVICE	SERVICE	PRICE	TOTAL
----------	---------	---------	-------	-------

QUANTITY	PART NUMBER	PART DESCRIPTION	PRICE	TOTAL
----------	-------------	------------------	-------	-------

6	911 111 189 03	EXHAUST GASKET	\$2.70	\$16.20
2	901 111 193 00	MUFFLER GASKET 911 65-74 47mm	\$4.98	\$9.96

VISIT US AT:

www.the-nurburgring.com

Thankyou!

Labor:	\$925.00
Parts:	\$2,298.48
Other:	
Tax:	\$149.40
Total:	\$3,372.88
Amount Paid:	\$3,372.88
Balance Due:	\$0.00

CUSTOMER #: 188519

12764

prestige

INVOICE

Lamborghini Paramus
 401 Route 17 South
 Paramus, NJ 07652
 Phone: (201) 267-8850
 lamborghini-paramus.com

VANTAGE SPORTSCARS INC
 6956 EDGEWATER DR STE 306
 ORLANDO, FL 32810
 HOME:407-497-2122 CONT:407-497-2122
 BUS: CELL:

PAGE 1

SERVICE ADVISOR: 200048 Hooman Mazaffari

COLOR	YEAR	MAKE/MODEL		VIN		LICENSE	MILEAGE IN / OUT	TAG
SILVER	73	PORSCH 911S		9113301032			26547/26547	TA190P
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED		PO NO.	RATE	PAYMENT	INV. DATE
31JAN20 DD			16:00 03FEB20			0.00	CASH	03FEB20
R.O. OPENED		READY		OPTIONS: SOLD-STK:A190P DLR:425059 TRN:MANUAL				

09:25 03FEB20 17:54 03FEB20

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A RE-CHECK VEHICLE BEFORE DELIVERY

CAUSE: PDI

RECHECK RE-CHECK VEHICLE BEFORE DELIVERY

200047 IUP 1.00

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE A: 0.00 (N/C)

26547 PDI PDI COMPLETED

B SUPPLY XL GASWERKS TSHIRT, L GASWERKS TSHIRT, 2 GASWERKS KEYCHAINS, GASWERKS HAT

SPO SUPPLY PARTS ONLY

99 IUP 0.00

2 3298GW KEYCHAIN

1 700072GD CAP,GOLD

2 5180BK BEFFY TEE SHIRT

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE B: 0.00 (N/C)

THANK YOU FOR CHOOSING LAMBORGHINI PARAMUS!!
 YOUR CONTINUED SUPPORT HAS ALLOWED US TO BE
 NAMED A TOP RATED LAMBORGHINI SERVICE CENTER
 FOR CUSTOMER RETENTION! WE ALSO OFFER FACTORY
 AUTHORIZED COLLISION REPAIR SERVICES. CALL US
 WHEN YOU ARE READY TO SELL YOUR EXOTIC CAR AT
 201.267.8850. TAG US @LAMBOPARAMUS

Original Estimate (Parts & Labor)	Authorized/Requested Add'l Repairs	Approved By:	Date & Time	Telephone # Called	ALL PARTS ARE NEW UNLESS OTHERWISE INDICATED.	DESCRIPTION	TOTALS
\$	\$					LABOR AMOUNT	0.00
						PARTS AMOUNT	0.00
						GAS, OIL, LUBE	0.00
Revised Estimate	\$					SUBLET AMOUNT	0.00
\$						*MISC. CHARGES	0.00
						TOTAL CHARGES	0.00
						LESS INSURANCE	0.00
						SALES TAX	0.00
						PLEASE PAY THIS AMOUNT	0.00

WARRANTY DISCLAIMER ALL PARTS AND ACCESSORIES ARE SOLD AND ALL REPAIRS ARE PROVIDED BY THE DEALERSHIP AS-IS. THE DEALERSHIP HEREBY DISCLAIMS ALL WARRANTIES, EXPRESS AND IMPLIED, INCLUDING ANY IMPLIED WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE, AND NEITHER ASSUMES NOR AUTHORIZES ANY OTHER PERSON TO ASSUME FOR IT ANY LIABILITY IN CONNECTION WITH THE SALE OF PARTS OR PRODUCTS OR THE REPAIR. THE ONLY WARRANTIES ON PARTS AND ACCESSORIES OR REPAIRS ARE THOSE WHICH MAY BE OFFERED BY THE MANUFACTURER OR THE ORIGINAL PARTS DISTRIBUTOR AND ONLY SUCH MANUFACTURER OR DISTRIBUTOR SHALL BE LIABLE FOR PERFORMANCE UNDER SUCH WARRANTIES. CUSTOMER SHALL NOT BE ENTITLED TO RECOVER FROM THE DEALERSHIP ANY CONSEQUENTIAL DAMAGES, DAMAGES TO PROPERTY, DAMAGES FOR LOSS OF USE, LOSS OF TIME, LOSS OF PROFIT OR INCOME, OR ANY OTHER INCIDENTAL DAMAGES.

By signing below, you acknowledge that you were notified of and authorized the Dealership to perform the services/repairs itemized in this invoice and that you received (or had the opportunity to inspect) any replaced parts as requested by you. The vehicle is being returned to you in exchange for your payment of the Amount Due.

DATE CUSTOMER SIGNATURE AUTHORIZED DEALERSHIP REPRESENTATIVE SIGNATURE

*SHOP SUPPLY COSTS: We have added a charge equal to 7% of the total cost of labor and parts, not to exceed \$34.99, to the Repair Order for shop supplies used in connection with this repair.

DealerCAP 2014 CDK Global, LLC (11/17) SERVICE INVOICE TYPE 2 - ZSR2 - "AS-IS" - NJ - 9608047

CUSTOMER COPY

CUSTOMER #: 2012678850

12039

prestige



INVOICE

Lamborghini Paramus

401 Route 17 South

Paramus, NJ 07652

Phone: (201) 267-8850

lamborghini-paramus.com

PARAMUS LAMBORGHINI

401 ROUTE 17 SOUTH

PARAMUS, NJ 07652

HOME: 201-267-8850 CONT: 201-267-8850

PAGE 1

BUS: CELL: SERVICE ADVISOR: 200036 TONY SULAJ

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG
SILVER	73	PORSCHE 911S	9113301032		27694/27694	T332

DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
15FEB19 DD			18:00 20SEP19		0.00	CASH	19SEP19

R.O. OPENED READY OPTIONS: STK:A190P DLR:425059 TRN:MANUAL

10:06 29MAY19 17:11 19SEP19

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A PERFORM ENGINE RESEAL

ENGINE ENGINE CONCERNS

40060	IUO	10.00					(N/C)
60	99970100640	VITON ORING					(N/C)
2	90110119500	DOWEL SLEEVE					(N/C)
2	93010511605	VALVE COVER					(N/C)
1	93010753301	GUIDE SLEEVE					(N/C)
2	99906402601	PLUG					(N/C)
1	91410314100	ROD BEARING SET					(N/C)
1	93010753101	SPRING					(N/C)
1	91110522205	TIMING CHAIN RAIL					(N/C)
1	90110753101	SPRING					(N/C)
2	99310552900	TIMING CHAIN					(N/C)
5	91110522207	TIMING CHAIN GUIDE					(N/C)
1	99610143570	INTERMEDIATE SHAFT B					(N/C)
1	91110190100	MAIN BEARING SET					(N/C)
6	93010432150	VALVE GUIDE					(N/C)
1	93010190200	ENGINE SUMP PLATE					(N/C)
1	90110202501	PILOT BEARING					(N/C)
24	990579052	ROCKER SHAFT ORING					(N/C)
4	90110735101	OIL RETURN PIPE					(N/C)
1	91110700805	OIL PUMP					(N/C)
1	99610113780	INTERMEDIATE SHAFT B					(N/C)
6	90110313101	WRIST PIN BUSHING					(N/C)
1	ARP6001	ARP ROD BOLT SET					(N/C)
1	ARP4206	HEAD STUD SET					(N/C)
1	EBSRVSSSET	RACING VALVE SPRING					(N/C)
12	EBSRVSSSEAT	RACING SPRING SEAT					(N/C)
12	90110338100	CIRCLIP					(N/C)
6	91110541120	INTAKE VALVE					(N/C)
6	91110541550	EXHAUST VALVE					(N/C)
6	93010432150	VALVE GUIDE					(N/C)
1	91110090500V	VITON GASKET SET					(N/C)
1	90111004103	OIL LINE					(N/C)

Original Estimate (Parts & Labor)	Authorized/Requested Add'l Repairs	Approved By:	Date & Time	Telephone # Called	* SHOP SUPPLY COSTS: We have added a charge equal to 7% of the total cost of labor, not to exceed \$34.99, to the Repair Order for shop supplies used in connection with this repair.	DESCRIPTION	TOTALS
\$	\$					LABOR AMOUNT	
						PARTS AMOUNT	
						GAS, OIL, LUBE	
						SUBLET AMOUNT	
						*MISC. CHARGES	
						TOTAL CHARGES	
						LESS INSURANCE	
						SALES TAX	
						PLEASE PAY THIS AMOUNT	

WARRANTY STATEMENT AND DISCLAIMER: PLEASE SEE THE DEALERSHIP'S LIMITED WARRANTY ON THE REVERSE SIDE OF THIS REPAIR INVOICE.

By signing below, you acknowledge that you were notified of and authorized the Dealership to perform the services/repairs itemized in this Invoice and that you received (or had the opportunity to inspect) any replaced parts as requested by you. The vehicle is being returned to you in exchange for your payment of the Amount Due.

ALL PARTS ARE NEW
UNLESS OTHERWISE
INDICATED.

DATE CUSTOMER SIGNATURE AUTHORIZED DEALERSHIP REPRESENTATIVE SIGNATURE

CUSTOMER #: 2012678850

12039

prestige



INVOICE

Lamborghini Paramus

401 Route 17 South

Paramus, NJ 07652

Phone: (201) 267-8850

lamborghini-paramus.com

PARAMUS LAMBORGHINI

401 ROUTE 17 SOUTH

PARAMUS, NJ 07652

HOME: 201-267-8850 CONT: 201-267-8850

PAGE 2

BUS: CELL: SERVICE ADVISOR: 200036 TONY SULAJ

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG
SILVER	73	PORSCHE 911S	9113301032		27694/27694	T332

DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
15FEB19 DD			18:00 20SEP19		0.00	CASH	19SEP19

R.O. OPENED READY OPTIONS: STK:A190P DLR:425059 TRN:MANUAL

10:06 29MAY19 17:11 19SEP19

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
12	99906700800		ROCKER ARM BOLT				(N/C)
12	93010504305		ROCKER ARM				(N/C)
12	90110534204		ROCKER ARM SHAFT				(N/C)
1	99919203040		INJECTION PUMP BELT				(N/C)
12	90110537002		VALVE ADJUSTING SCREW				(N/C)
12	90110534403		ROCKER ARM BOLT				(N/C)
12	90110537603		NUT				(N/C)
12	99903400500		LOCKING NUT				(N/C)
1	05262		RACE CAMS				(N/C)
2	93010536200		OIL SPLASH TUBE				(N/C)
6	90110537900		CAM OIL TUBE PLUG				(N/C)
2	99310516350		WASHER				(N/C)
2	90008207201		CAMSHAFT BOLT				(N/C)
2	99310516350		WASHER				(N/C)
2	90142455701		GUIDE TUBE				(N/C)
2	90008207201		CAMSHAFT BOLTS				(N/C)
1	90111006098S		ROD LINKAGE				(N/C)
2	901116825111		RELEASE ARE				(N/C)
1	SIC110021SET		INJECTION LINE				(N/C)
4	NGK		SPARK PLUG				(N/C)
1	911107041022		OIL COOLER				(N/C)
10	90110556100A		SHIM				(N/C)
4	0127082		WOODRUFF KEY				(N/C)
3	N02035327		4MM VAC HOSE				(N/C)
1	9991921765A		BELT 10X710				(N/C)
1	F300024359		COIL				(N/C)
4	PCG51117402		PIPE CLAMP				(N/C)
10	90004100501		CIRCLIP				(N/C)
8	99906103402		STUD 10X67				(N/C)
8	999062192002		STUD M10X102				(N/C)
1	91111029502		HOT AIR TUBE				(N/C)
1	93010776403		OIL FILTER				(N/C)
12	20W50		BRAD PENN 20W50				(N/C)
1	16AMP		CERAMIC FUSE				(N/C)

Original Estimate (Parts & Labor)	Authorized/Requested Add'l Repairs	Approved By:	Date & Time	Telephone # Called	* SHOP SUPPLY COSTS: We have added a charge equal to 7% of the total cost of labor, not to exceed \$34.99, to the Repair Order for shop supplies used in connection with this repair.	DESCRIPTION	TOTALS
\$	\$					LABOR AMOUNT	
						PARTS AMOUNT	
						GAS, OIL, LUBE	
						SUBLET AMOUNT	
						*MISC. CHARGES	
						TOTAL CHARGES	
						LESS INSURANCE	
						SALES TAX	
						PLEASE PAY THIS AMOUNT	

WARRANTY STATEMENT AND DISCLAIMER: PLEASE SEE THE DEALERSHIP'S LIMITED WARRANTY ON THE REVERSE SIDE OF THIS REPAIR INVOICE.

By signing below, you acknowledge that you were notified of and authorized the Dealership to perform the services/repairs itemized in this Invoice and that you received (or had the opportunity to inspect) any replaced parts as requested by you. The vehicle is being returned to you in exchange for your payment of the Amount Due.

ALL PARTS ARE NEW UNLESS OTHERWISE INDICATED.

DATE CUSTOMER SIGNATURE AUTHORIZED DEALERSHIP REPRESENTATIVE SIGNATURE

CUSTOMER #: 2012678850

12039

prestige



INVOICE

Lamborghini Paramus

401 Route 17 South

Paramus, NJ 07652

Phone: (201) 267-8850

lamborghini-paramus.com

PARAMUS LAMBORGHINI

401 ROUTE 17 SOUTH

PARAMUS, NJ 07652

HOME: 201-267-8850 CONT: 201-267-8850

PAGE 3

BUS: CELL: SERVICE ADVISOR: 200036 TONY SULAJ

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG
SILVER	73	PORSCHE 911S	9113301032		27694/27694	T332

DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
15FEB19 DD			18:00 20SEP19		0.00	CASH	19SEP19

R.O. OPENED READY OPTIONS: STK:A190P DLR:425059 TRN:MANUAL

10:06 29MAY19 17:11 19SEP19

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
	2	25AMP	CERAMIC	FUSE			(N/C)
	40	N0107108	SHROUD	SCREWS			(N/C)
	1	90174155102	SENDING	UNIT			(N/C)
	2	90163210128	INTERIOR	LIGHT			(N/C)
	2	90150475901	COVER	SEAL			(N/C)
	2	91156404500	GUIDE	PIECE			(N/C)

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE A: 0.00
27694

remove engine and transmission / mount engine on stand tear down
start the cleaning / inspection
n on internal engine parts needed start to assemble engine check
crankshaft journal diameters install reconditioned rods install ARP rod
bolts rebuild throttle bodies repair throttle linkages on MFI

B PERFORM TRANS RESEAL

P27 PORSCHE TRANSMISSION

40060	IUO	5.00	(N/C)
1	91530091101A	GASKET KIT	(N/C)
1	91511601122	CLUTCH DISC	(N/C)
2	99920147000	NEEDLE BEARINGS	(N/C)
2	91442392202	END BOOT, CLUTCH	(N/C)

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE B: 0.00

27694 dis assemble gear box re seal gear box replace 5 th gear
needle bearing

SUBL ENGINE MACHINE WORK

PO#24002

IUO

(N/C)

SUBL H&R FUEL INJECTION - TEST AND CLEAN INJECTORS. TEST INJECTIONS

PUMP, REBUILT AND RECALIBRATE INJECTION PUMP.

PO#24002

IUO

(N/C)

SUBL YELLOW CADMIUM

PO#24002

Original Estimate (Parts & Labor)	Authorized/Requested Add'l Repairs	Approved By:	Date & Time	Telephone # Called	* SHOP SUPPLY COSTS: We have added a charge equal to 7% of the total cost of labor, not to exceed \$34.99, to the Repair Order for shop supplies used in connection with this repair.	DESCRIPTION	TOTALS
\$	\$					LABOR AMOUNT	
						PARTS AMOUNT	
						GAS, OIL, LUBE	
						SUBLET AMOUNT	
						*MISC. CHARGES	
						TOTAL CHARGES	
						LESS INSURANCE	
						SALES TAX	
						PLEASE PAY THIS AMOUNT	

**WARRANTY STATEMENT AND DISCLAIMER: PLEASE SEE THE DEALERSHIP'S
LIMITED WARRANTY ON THE REVERSE SIDE OF THIS REPAIR INVOICE.**

By signing below, you acknowledge that you were notified of and authorized the
Dealership to perform the services/repairs itemized in this Invoice and that you received
(or had the opportunity to inspect) any replaced parts as requested by you. The vehicle
is being returned to you in exchange for your payment of the Amount Due.

**ALL PARTS ARE NEW
UNLESS OTHERWISE
INDICATED.**

DATE CUSTOMER SIGNATURE AUTHORIZED DEALERSHIP REPRESENTATIVE SIGNATURE

CUSTOMER #: 2012678850

12039

prestige



INVOICE

Lamborghini Paramus

401 Route 17 South

Paramus, NJ 07652

Phone: (201) 267-8850

lamborghini-paramus.com

PARAMUS LAMBORGHINI

401 ROUTE 17 SOUTH

PARAMUS, NJ 07652

HOME: 201-267-8850 CONT: 201-267-8850

PAGE 4

BUS: CELL: SERVICE ADVISOR: 200036 TONY SULAJ

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG
SILVER	73	PORSCHE 911S	9113301032		27694/27694	T332

DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
15FEB19 DD			18:00 20SEP19		0.00	CASH	19SEP19

R.O. OPENED READY OPTIONS: STK:A190P DLR:425059 TRN:MANUAL

10:06 29MAY19 17:11 19SEP19

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
				IUO			(N/C)

SUBL LOT ZINC

PO#24002

IUO

(N/C)

SUBL LOT, ZINC, NICKEL AND CAD

PO#24002

IUO

(N/C)

SUBL LOT CAD YELLOW

PO#24002

IUO

(N/C)

SUBL LOT CAD YELLOW

PO#24002

IUO

(N/C)

SUBL 1 LOT CADMIUM YELLOW

PO#24002

IUO

(N/C)

THANK YOU FOR CHOOSING LAMBORGHINI PARAMUS!!
 YOUR CONTINUED SUPPORT HAS ALLOWED US TO BE
 NAMED A TOP RATED LAMBORGHINI SERVICE CENTER
 FOR CUSTOMER RETENTION! WE ALSO OFFER FACTORY
 AUTHORIZED COLLISION REPAIR SERVICES. CALL US
 WHEN YOU ARE READY TO SELL YOUR EXOTIC CAR AT
 201.267.8850. TAG US @LAMBOPARAMUS

Original Estimate (Parts & Labor)	Authorized/Requested Add'l Repairs	Approved By:	Date & Time	Telephone # Called	* SHOP SUPPLY COSTS: We have added a charge equal to 7% of the total cost of labor, not to exceed \$34.99, to the Repair Order for shop supplies used in connection with this repair.	DESCRIPTION	TOTALS
\$	\$				ALL PARTS ARE NEW UNLESS OTHERWISE INDICATED.	LABOR AMOUNT	0.00
						PARTS AMOUNT	0.00
						GAS, OIL, LUBE	0.00
						SUBLET AMOUNT	0.00
						*MISC. CHARGES	0.00
						TOTAL CHARGES	0.00
						LESS INSURANCE	0.00
Revised Estimate \$	\$					SALES TAX	0.00
WARRANTY STATEMENT AND DISCLAIMER: PLEASE SEE THE DEALERSHIP'S LIMITED WARRANTY ON THE REVERSE SIDE OF THIS REPAIR INVOICE. By signing below, you acknowledge that you were notified of and authorized the Dealership to perform the services/repairs itemized in this Invoice and that you received (or had the opportunity to inspect) any replaced parts as requested by you. The vehicle is being returned to you in exchange for your payment of the Amount Due.						PLEASE PAY THIS AMOUNT	0.00
DATE		CUSTOMER SIGNATURE		AUTHORIZED DEALERSHIP REPRESENTATIVE SIGNATURE			