



NAPLES PORSCHE

800 NORTH TAMiami TRAIL • NAPLES, FLORIDA 34102
TELEPHONE (239) 280-5100
FAX (239) 263-0984
STATE OF FLORIDA
REGISTRATION: MV - 52106

POCS53300



POCS53300

PLEASE SEE REVERSE SIDE FOR INFORMATION REGARDING REPAIRS

CUSTOMER NO.	ADVISOR EDISSON GONZALEZ	TAG NO. 1556 370	INVOICE DATE 07/09/15	POCS53300
	LABOR RATE	LICENSE NO.	MILEAGE 3,062 /	COLOR
	YEAR / MAKE / MODEL 05/PORSCHE/CARRERA GT/2DR CPE		DELIVERY DATE	DELIVERY MILES
	VEHICLE I.D. NO. W P 0 C A 2 9 8 2 5 L 0 0 1 3 6 4		SELLING DEALER NO.	PRODUCTION DATE
	F.T.E. NO.	P.O. NO.	R.O. DATE 07/06/15	
RESIDENCE PHONE	PUBLICED SUPPLY	COMMENTS	MILEAGE OUT MO: 3064	

LABOR & PARTS

J# 1 01POANNUAL ANNUAL SERVICE TECH(S):622 1160.00

PERFORM PREFERRED ANNUAL MAINTENANCE FOR LOW MILEAGE VEHICLES
NO CHEMICALS
CUSTOMER REQUESTED PREFERRED MAINTANENCE
PERFORMED ANNUAL SERVICE TO PORSCHE SPECIFICATIONS.
PERFORMED LUBE, OIL AND FILTER SERVICE.
CHECKED ALL VISABLE FLUIDS, TOPPED OFF
WASHER SOLVENT, CHECKED ALL LIGHTS AND WIPER BLADES, SET
ALL TIRE PRESSURES, ROADTESTED CAR.
CHECK ENGINE MANAGEMENT FAULT HISTORY
RESET SERVICE REMINDER
CLEAN FUEL INJECTORS
CHECK HORNS, LIGHTS AND EXTERIOR EQUIPMENT
INSPECT UNDERBODY, BELTS AND HOSES
CHECK RADIATORS FOR BLOCKAGE AND CLEAR DEBRIS
CLEAN AND LUBRICATE DOOR, DECKLID AND TOP SEALS
CHECK AND CLEAN AIR CONDITIONG DRAINS
CHECK AND CLEAR BODY DRAINS
INSPECT MECHANICAL AND HYDRAULIC BRAKING SYSTEM
INSPECT SUSPENSION AND STEERING

**ALL PARTS
ARE NEW
UNLESS
OTHERWISE
INDICATED**

PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE
JOB # 1	1	996-107-225-53	OIL-FILTER INSER	35.70
JOB # 1	1	900-331-042-40	O-RING	21.87
JOB # 1	1	900-123-118-30	ALUM SEAL RING	2.30
JOB # 1	1	900-123-006-25	SEAL RING	6.93
JOB # 1	12	WTY-000-003-A	MOBIL-1 SYNTH	8.88
JOB # 1	1	000-043-206-89	ADDITIVE 100 ML	8.98
JOB # 1	1	000-044-000-87	WINDOW CLEANER	8.62
JOB # 1	1	6536	BRAKE CLNR 140Z	9.75

JOB # 1 TOTAL PARTS 200.71

JOB # 1 TOTAL LABOR & PARTS 1360.71

J# 2 01POFLUSH BRAKE FLUID FLUSH TECH(S):622 213.69

CLIENT REQUESTS TWO (2) YEAR BRAKE FLUID FLUSH, PER FACTORY RECOMMENDATION
REMOVED WHEELS, FLUSHED BRAKE FLUID WITH NEW GENUINE PORSCHE
HIGH TEMPERATURE BRAKE FLUID AND INSPECTED HYDRAULIC AND
MECHANICAL BRAKE SYSTEM

PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE
JOB # 2	1	000-043-203-66	ORMD-BRAKE FLUID	36.84

JOB # 2 TOTAL PARTS 36.84

JOB # 2 TOTAL LABOR & PARTS 250.53

J# 3 51POZ04 AIRBAG LIGHT TECH(S):622 INTERNAL

CUSTOMER STATES AIRBAG WARNING LIGHT IS ON, CHECK AND ADVISE
TECHNICIAN CHECKED FOR FAULTS FOUND CODES #21 NOT PRESENT.
TECHNICIAN CLEARED FUALTS, TEST DROVE VEHICLE, LIGHT NO
LONGER PRESENT.



NAPLES PORSCHE

800 NORTH TAMiami TRAIL • NAPLES, FLORIDA 34102
TELEPHONE (239) 280-5100
FAX (239) 263-0984
STATE OF FLORIDA
REGISTRATION: MV - 52106

POCS53300



POCS53300

PLEASE SEE REVERSE SIDE FOR INFORMATION REGARDING REPAIRS

CUSTOMER NO.	ADVISOR EDISSON GONZALEZ	TAG NO. 1556 370	INVOICE DATE 07/09/15	INVOICE NO. POCS53300
	LABOR RATE	LICENSE NO.	COLORED 3.062 /	STOCK NO.
	YEAR / MAKE / MODEL 05/PORSCHE/CARRERA GT/2DR CPE	DELIVERY DATE	DELIVERY MILES	
	VEHICLE I.D. NO. W P 0 C A 2 9 8 2 5 L 0 0 1 3 6 4	SELLING DEALER NO.	PRODUCTION DATE	
	P.T.E. NO.	P.O. NO.	R.O. DATE 07/06/15	
RESIDENCE PHONE	BUSINESS PHONE	COMMENTS	MILEAGE OUT	MO: 3064

PARTS-----QTY---FP-NUMBER-----DESCRIPTION-----UNIT PRICE-
JOB # 3 TOTAL PARTS 0.00
JOB # 3 TOTAL LABOR & PARTS 0.00

J# 4+51P0Z BODY ELECTRICAL TECH(S):622 580.00
TECHNICIAN NOTED STARTED FAULTY AT START.
FAULTY STARTER CLICKING WHEN START COLD.
TECHNICIAN REMOVED UNDERCARRIAGE PANELS AND REPLACED
STARTED UNIT.

PARTS-----QTY---FP-NUMBER-----DESCRIPTION-----UNIT PRICE-
JOB # 4 1 996-604-103-X STARTER-REBUILT 744.22
JOB # 4 -1 996-604-103-X CORE RETURN 403.20
JOB # 4 TOTAL PARTS 341.02
JOB # 4 TOTAL LABOR & PARTS 921.02

J# 5+61P0Z19 BODY ADJUSTMENTS TECH(S):622 1160.00
TECHNICIAN NOTED DURING REPAIR SHIFTER CABLES ARE PRESSED
AGAINST ENGINE BAY COMPARTMENT FROM PREVIOUS REPAIR.
SHIFTER CABLE WAS STUCK BETWEEN HEADER AND LOWER UNIT CARRIER
R&I LOWER PART OF UNIT CARRIER AND REROUTED SHIFTER CABLE
TO CORRECT POSTION

PARTS-----QTY---FP-NUMBER-----DESCRIPTION-----UNIT PRICE-
JOB # 5 TOTAL PARTS 0.00
JOB # 5 TOTAL LABOR & PARTS 1160.00

MISC-----CODE-----DESCRIPTION-----CONTROL NO-----
JOB # A SS ENVIRONMENTAL DISPOSAL FEE 45.00
TOTAL - MISC 45.00

COMMENTS-----
STARTER REPLACEMENT \$ 1694

ALL PARTS
ARE NEW
UNLESS
OTHERWISE
INDICATED



NAPLES PORSCHE

800 NORTH TAMiami TRAIL • NAPLES, FLORIDA 34102
TELEPHONE (239) 280-5100
FAX (239) 263-0984
STATE OF FLORIDA
REGISTRATION: MV - 52106

POCS53300



POCS53300

PLEASE SEE REVERSE SIDE FOR INFORMATION REGARDING REPAIRS

CUSTOMER NO.	ADVISOR EDISSON GONZALEZ	TAG NO. 1556 370	INVOICE DATE 07/09/15	POCS53300
	LABOR RATE	LICENSE NO.	COLOR /	STOCK NO.
		MILEAGE 3,062	DELIVERY DATE	DELIVERY MILES
	YEAR / MAKE / MODEL 05/PORSCHE/CARRERA GT/2DR CPE			PRODUCTION DATE
	VEHICLE I.D. NO. W P 0 C A 2 9 8 2 5 L 0 0 1 3 6 4			
	F.T.E. NO.	P.O. NO.	R.O. DATE 07/06/15	
RESIDENCE PHONE	BUSINESS PHONE	COMMENTS	MILEAGE OUT MO: 3064	

TOTALS.....

TOTAL LABOR....	3113.69
TOTAL PARTS....	578.57
TOTAL SUBLET...	0.00
TOTAL G.O.G....	0.00
TOTAL MISC CHG.	45.00
TOTAL MISC DISC	0.00
TOTAL TAX.....	224.24

TOTAL INVOICE \$ 3961.50

**ALL PARTS
ARE NEW
UNLESS
OTHERWISE
INDICATED**

THANK YOU FOR CHOOSING PORSCHE OF NAPLES FOR YOUR SERVICE NEEDS. YOU MAY RECEIVE A SURVEY REQUEST ABOUT YOUR VISIT AND EXPERIENCE TODAY. IF FOR ANY REASON YOU CANNOT GRADE US "EXCELLENT" IN ALL AREAS OF THE SURVEY, PLEASE CONTACT ME. DAVID ESPINOSA, SERVICE MANAGER AT 239-280-5140, WITH ANY CONCERNS YOU MAY HAVE.

CUSTOMER SIGNATURE



PORSCHE

The Porsche Multi-Point Inspection Report

The Porsche Multi-Point Inspection Report is a series of thorough vehicle "health checks" performed by factory-trained Porsche technicians. It is designed to keep your Porsche operating in top condition and to minimize your chances of being inconvenienced on the road. If additional service is recommended on any listed item, your Porsche Service Advisor will be happy to speak with you about your options.

Customer Name

3062

Year/Model

WPOCA29825L001364

Engine Size

Date

7/6/15

RO/Tag

Mileage

Checked and Okay at this Time

May Require Future Attention

Requires Immediate Attention

Check Fluid Levels and Fill

OK FILL

OK FILL

- | | |
|--|--|
| <input checked="" type="checkbox"/> Engine Oil | <input checked="" type="checkbox"/> Brake Reservoir |
| <input checked="" type="checkbox"/> Windshield Washer | <input checked="" type="checkbox"/> Headlamp Washer |
| <input checked="" type="checkbox"/> Power Steering | <input checked="" type="checkbox"/> Coolant Recovery Reservoir |
| <input checked="" type="checkbox"/> Transmission (if equipped w/ dipstick) | |

Check Following Systems / Components

- | | | |
|-------------------------------------|-------------------------------------|--|
| <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | Operation of horn, interior lights, exterior lamps, turn signals, hazard and brake lamps |
| <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | Visually inspect headlamp alignment |
| <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | Windshield washer spray, wiper operation and wiper blades |
| <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | Windshield cracks and/or chips |
| <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | Heating, ventilation and air conditioning check |
| <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | Engine air cleaner filter |
| <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | Oil and/or fluid leaks |
| <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | Constant velocity (CV) drive axle boots (if equipped) |
| <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | Exhaust system (leaks, damage, loose parts) |
| <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | Steering and steering linkages |
| <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | Shocks/struts, air suspension and other suspension components for leaks and/or damage |
| <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | Brake system (including lines, hoses and parking brake) |
| <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | Engine cooling system, hoses and clamps |
| <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | Radiator, heater and air conditioning hoses for leaks / damage |
| <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | Accessory drive belt(s) |
| <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | Clutch operation (if equipped) |
| <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | State inspection due (if applicable) |
| <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | Your last completed maintenance |
| <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | Your next factory scheduled maintenance is due at |

Month / Day / Year

Mileage / Month / Year

Mileage / Month / Year

Comments:

- STARTED faulty
- shock cables not properly lubricated

This Courtesy Inspection Completed By Your Porsche Service Team

Service Advisor:

Technician:

Customer Signature:

PNA 000 012 ed. 05/08

Check Battery Condition

Good
Comments:

Recharge

Bad

Check Brakes


Measure Front / Rear Brake Linings

RF

RR

LF

LR

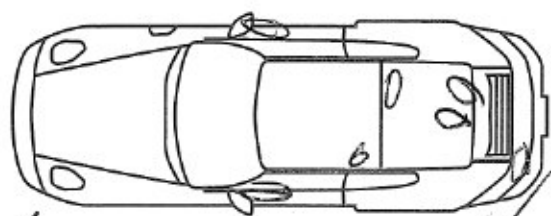

Over 5mm or 7/32"

3 to 5mm or 4/32" to 7/32"

Less than 3mm or 4/32"

Brake Measurements Not Taken This Service Visit

Comments:

Check Tires

TREAD DEPTH

LF

- ☒ 7/32" or Greater
- ☐ 4/32" to 6/32"
- ☐ 3/32" or Less

- ☒ 7/32" or Greater
- ☐ 4/32" to 6/32"
- ☐ 3/32" or Less

LR

- ☒ LF
- ☐ LR

Wear Pattern / Damage
Tire Wear Indicators

Alignment Check Recommended

Wheel Balance Recommended

Comments:

Tire Pressure Set to

Factory Recommendations

PSI

36

Front

36

Rear



NAPLES PORSCHE

800 NORTH TAMiami TRAIL • NAPLES, FLORIDA 34102
TELEPHONE (239) 280-5100
FAX (239) 263-0984
STATE OF FLORIDA
REGISTRATION: MV - 52106



PLEASE SEE REVERSE SIDE FOR INFORMATION REGARDING REPAIRS

CUSTOMER NO.	ADVISOR ALICIA COUGHLIN	566	TAG NO. 203	INVOICE DATE 08/06/13	INVOICE NO. POCS45894
	LABOR RATE	LICENSE NO.	MILEAGE 2,797	COLOR /	STOCK NO.
	YEAR / MAKE / MODEL 05/PORSCHE/CARRERA GT/2DR CPE			DELIVERY DATE	DELIVERY MILES
	VEHICLE I.D. NO. W P 0 C A 2 9 8 2 5 L 0 0 1 3 6 4			SELLING DEALER NO.	PRODUCTION DATE
	F.T.E. NO. 21-8012788740-0		P.O. NO.	R.O. DATE 08/01/13	
RESIDENCE PHONE	COMMENTS				MILEAGE OUT MO: 2830

LABOR & PARTS

J# 1 46POZ01 WHEEL/TIRE CONCERN TECH(S):479 540.00

CUSTOMER STATES NEEDS RECALIBRATE TPMS
RR RDK ANTENNA INOP. CANNOT SEE FOURTH WHEEL FOR CALIBRATION
RR ANTENNA INOP
CHECK FOR FAULTS. ONE FAULT FOR 800C -INCOMPLETE LEARNING
PROCESS. TEST DRIVE TO COMPLETE PROCESS. UNABLE TO FINISH
CALIBRATION. SYSTEM STUCK IN LEARNING MODE. FOUR SENSORS
TAUGHT. UNABLE TO ASSIGN LOCATION TO FOURTH. MISSING LR
INPUT. UNABLE TO MANUALLY TEACH WITH NEWEST TESTER.
DISCONNECT CU AND CLEAR MEMORY FOR VALUES. UNABLE TO TEACH.
USE OLD PS2 TESTER TO MANUALLY INPUT VALUES FOR NEW SENSORS.
SUCCESSFULLY TAUGHT. MISSING RR READING - REPLACE RR ANT.

**ALL PARTS
ARE NEW
UNLESS
OTHERWISE
INDICATED**

PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE
JOB # 1	1	997-606-101-00	ANTENNA , INFLAT	267.36
JOB # 1	1	997-606-225-00	CLIP	17.50
JOB # 1 TOTAL PARTS				284.86
JOB # 1 TOTAL LABOR & PARTS				824.86

TOTALS

TOTAL LABOR....	540.00
TOTAL PARTS....	284.86
TOTAL SUBLET...	0.00
TOTAL G.O.G....	0.00
TOTAL MISC CHG.	0.00
TOTAL MISC DISC	0.00
TOTAL TAX.....	0.00

TOTAL INVOICE \$ 824.86

THANK YOU FOR CHOOSING PORSCHE OF NAPLES FOR YOUR SERVICE
NEEDS. YOU MAY RECEIVE A SURVEY REQUEST ABOUT YOUR VISIT AND
EXPERIENCE TODAY. IF FOR ANY REASON YOU CANNOT GRADE US
"EXCELLENT" IN ALL AREAS OF THE SURVEY, PLEASE CONTACT ME.
WAYNE RAM, SERVICE MANAGER AT 239-280-5140, WITH ANY
CONCERNS YOU MAY HAVE.

CUSTOMER SIGNATURE

Manfred's Automotive, Inc.D/B/A F1 Imports & Exotics

568 Industrial Blvd.

Naples, FL

34104

Tel. #: (239) 430-2206 FAX: (239) 430-2208

CUSTOMER			VEHICLE			INVOICE ADMIN.		
			2005 PORSCHE CARRERA GT			INV # : 12147		
			Plate :			Date : 08/02/2013		
			ODO : 2,845			Time : 10:18AM		
			V.I.N.: WP0CA29825L001364			PO # :		
			Unit #:			REG # : MV56865		
			Engine: V10 5.7L 5733CC 350CI			Tech. : Multiple/		
Qty	Hrs.	Description	Parts Ea.	Tot.Parts	Labour	Tx	Total	C
3.00		Perform oil change & inspection, which includes, renew oil & oil filter, check & top-up fluids, set tire pressures, check lights and lube hinges & latches.			315.00	TX1	315.00	
						TX1		
						TX1		
						TX1		
						TX1		
						TX1		
1.50		Renew brake & clutch fluid.			157.50	TX1	157.50	
		NOTE:				TX1		
		Recommend new tires due to age.				TX1		
		-----				TX1		
1.00		Filter, Oil	29.32	29.32		TX1	29.32	
11.00		Mobil One 0w40	9.99	109.89		TX1	109.89	
2.00		Seal rings	1.98	3.96		TX1	3.96	
5.00		Brake Fluid, Pint	6.99	34.95		TX1	34.95	
		Shop Supplies	10.69	10.69	4.73	TX1	15.42	

WO# 8815 08/02/2013 10:11AM

Copyright 2013 Autogence Inc. - LANKAR 9.0.71

Dear Customer,

Concerning your air conditioning system repair, Most of the repairs have a warranty. This does not imply that all of the A/C system is covered, It is Not. This warranty applies only to that specific repair and any loss of freon (30 days) due to that repair.

Also Note: under any circumstances a receiver drier/filter is recommended but declined, this will void any & all warranties.

PAID BY:...

08/02/2013 On Account 706.00 ** UNPAID BALANCE **

Any warranties on parts and accessories sold hereby are made by the manufacture. The above shop disclaims all warranties, including implied warranties of merchantability or fitness for the particular purpose, and does not authorize for any person to assume for any liability.

Hazmat & Shop Supplies charges represent cost & profit to Manfred's Automotive for waste disposal and miscellaneous shop supplies used in performing service to your vehicle. I.e. towels, chemicals, and fluids.

Payment is due upon receipt of vehicle after completion. There is a 7-day grace period; any payment not received after seven days will have an 18% APR interest applied to all remaining balances.

Manfred's Automotive, Inc. will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident, or any other cause beyond your control.

Storage begins 3 days after notified repairs completed. A \$30.00 per day storage fee will apply to those who are not prompt to picking up their vehicles.

Sub Tot.	188.81	477.23	666.04
		TX1	39.96
		TX2	0.00
		Deductible	0.00
		Total	706.00

Page

1 of 1

Manfred's Automotive, Inc.D/B/A F1 Imports & Exotics

568 Industrial Blvd.

Naples, FL

34104

Tel. #: (239) 430-2206 FAX: (239) 430-2208

CUSTOMER		VEHICLE	INVOICE ADMIN.					
		2005 PORSCHE CARRERA GT	INV # : 12146					
		Plate :	Date : 08/02/2013					
		ODO : 2,845	Time : 10:02AM					
		V.I.N.: WPOCA29825L001364	PO # :					
		Unit #:	REG # : MV56865					
		Engine: V10 5.7L 5733CC 350CI	Tech. : Multiple/					
Qty	Hrs.	Description	Parts Ea.	Tot.Parts	Labour	Tx	Total	C
2.00		Remove lower trays and evaluate.			180.00	N	180.00	
						N		
10.00		Remove exterior body panels as needed to access center frame separation point.			900.00	N	900.00	
						N		
						N		
5.00		Set-up support lift and separate powertrain and support.			450.00	N	450.00	
						N		
						N		
3.00		Open tank and remove fuel pump assemblies.			270.00	N	270.00	
						N		
4.00		Research and locate fuel pump assemblies.			360.00	N	360.00	
						N		
3.00		Refit tank with new fuel pumps.			270.00	N	270.00	
						N		
2.50		Set-up run simulation system and bench run 20gal fuel varying between idle and full throttle conditions.			225.00	N	225.00	
						N		
						N		
						N		
18.00		Reassemble vehilce, includes brake and clutch bleed, cooling system bleed & pressure test.			1,620.00	N	1,620.00	
						N		
						N		
						N		
1.00		Replace cooling pipe for leak.			90.00	N	90.00	
2.50		Remove and replace oil pump mount o-rings and install missing snap ring.			225.00	N	225.00	
						N		
						N		

Any warranties on parts and accessories sold hereby are made by the manufacture. The above shop disclaims all warranties, including implied warranties of merchantability or fitness for the particular purpose, and does not authorize for any person to assume for any liability.

Hazmat & Shop Supplies charges represent cost & profit to Manfred's Automotive for waste disposal and miscellaneous shop supplies used in performing service to your vehicle. I.e. towels, chemicals, and fluids.

Payment is due upon receipt of vehicle after completion. There is a 7-day grace period; any payment not received after seven days will have an 18% APR interest applied to all remaining balances.

Manfred's Automotive, Inc. will not be held responsible for loss or damage to vehicle or articles left in vehicle incase of fire, theft, accident, or any other cause beyond your control.

Storage begins 3 days after notified repairs completed. A \$30.00 per day storage fee will apply to those who are not prompt to picking up their vehicles.

Other Charges			79.80
Sub Tot.	1,372.85	4,595.00	6,047.65
	TX1		0.00
	TX2		0.00
	Deductible		0.00
	Total		6,047.65

Manfred's Automotive, Inc.D/B/A F1 Imports & Exotics

568 Industrial Blvd.

Naples, FL

34104

Tel.#: (239) 430-2206 FAX: (239) 430-2208

CUSTOMER

VEHICLE

INVOICE ADMIN.

2005 PORSCHE CARRERA GT

Plate :

ODO : 2,845

V.I.N.: WPOCA29825L001364

Unit #:

Engine: V10 5.7L 5733CC 350CI

INV # : 12146

Date : 08/02/2013

Time : 10:02AM

PO # :

REG # : MV56865

Tech. : Multiple/

Qty	Hrs.	Description	Parts Ea.	Tot.Parts	Labour	Tx	Total	PC
		Test drive				N		
		-----				N		
2.00		Fuel Pump	445.60	891.20		N	891.20	
		20x FUEL				N	79.80	
1.00		AS vent line	217.24	217.24		N	217.24	
6.00		O- Ring	6.80	40.80		N	40.80	
3.00		O-ring	6.80	20.40		N	20.40	
1.00		Lock Ring	13.56	13.56		N	13.56	
9.00		Sealing ring	4.52	40.68		N	40.68	
1.00		Porsche antifreeze	45.15	45.15		N	45.15	
1.00		Porsche antifreeze	45.15	45.15		N	45.15	
1.00		CHF20	26.68	26.68		N	26.68	
1.00		Brake Fluid, Pint	6.99	6.99		N	6.99	
		Shop Supplies	25.00	25.00	5.00	N	30.00	

WO# 6785 07/17/2013 11:30AM

Copyright 2013 Autogance Inc. - LANKAR 9.0.71

Dear Customer,

Concerning your air conditioning system repair. Most of the repairs have a warranty. This does not imply that all of the A/C system is covered, It is Not. This warranty applies only to that specific repair and any loss of freon (30 days) due to that repair.

Also Note: under any circumstances a receiver drier/filter is recommended but declined, this will void any & all warranties.

PAID BY:...

08/02/2013 On Account 6,047.65 ** UNPAID BALANCE **

Any warranties on parts and accessories sold hereby are made by the manufacture. The above shop disclaims all warranties, including implied warranties of merchantability or fitness for the particular purpose, and does not authorize for any person to assume for any liability.

Hazmat & Shop Supplies charges represent cost & profit to Manfred's Automotive for waste disposal and miscellaneous shop supplies used in performing service to your vehicle. I.e. towels, chemicals, and fluids.

Payment is due upon receipt of vehicle after completion. There is a 7-day grace period; any payment not received after seven days will have an 18% APR interest applied to all remaining balances.

Manfred's Automotive, Inc. will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident, or any other cause beyond your control.

Storage begins 3 days after notified repairs completed. A \$30.00 per day storage fee will apply to those who are not prompt to picking up their vehicles.

Other Charges 79.80

Sub Tot. 1,372.85 4,595.00 6,047.65

TX1 0.00

TX2 0.00

Deductible 0.00

Total 6,047.65

Page

2 of 2

Standard processes — Campaign

Current vehicle:

Model range	Model year	Model type	VIN
980	2005 - 5	980310	WP0CA29825L001364

This list contains your selected campaigns.

Please select a campaign from the list:

Campaign number	Campaign text	Type	Status	Scope of work
W735	W735 - Retrofitting Retaining Ring on Transmission (Workshop Campaign)	Standard processes	Completed campaigns	1
W607	W607 - Replacing Retainer Spring In Lower Henn Coupling On The Two Front Side Radiators (Workshop Campaign)	Standard processes	Completed campaigns	1

[BACK](#)[RESET](#)[TOP](#)

Vehicle-
Ident.-Number (VIN) WP0CA29825L001364 Display Close en

M-numbers

Warranty data

Vehicle description

Vehicle-
Ident.-Number (VIN) WP0CA29825L001364
Sales Type 980310 Carrera GT
Model Year 2005
Block Flag
Blocking Date
Engine Type M80/01
engine number 90531036
Gearbox Type G8001
transmission serial number 00002809
Tire Code 6UOW

General information

Invoice Date 1 2005-06-03
Invoice Date 2
Number of "Z"
Orders 2
Country C02 USA
Equipment
Trading Partner 4300010
Commission Number 552040

Body specifications

body color LM7Z
Exterior Paint Color U2U2
Exterior Paint Color GT Silver Metallic / GT Silver Metallic

Interior specifications

Interior Trim MZ
Interior Trim Leather interior in terracotta
Interior Equipment Code LE Leather
Seat Combination Number FJA
Seat Cushion Material LED Leather
Seat Side Support Material LE Leather
Seat Back Material
Carpet Color Code 8B2

Electrical system/electronics specifications

DME serial number 09.03.05281
433 0005712546

	from	to	contract date	coverage	Assistance	mileage limit
New vehicle warranty	16.Jul.2005	16.Jul.2009			no	81.000km
Corrosion warranty	16.Jul.2009	17.Jul.2015				- km
Emission warranty	16.Jul.2009	16.Jul.2012				112.000km

Campaigns

Description	Scope	Status	Stop sales
W607 Henn connector retainer	1	1	no
W735 RETAINING RING	1	1	no

"Z" Orders

"Z" Order Number	Text	Description
24271		CT-Einbau nach ZP 8
24381		Plaketten-Nr.

TPM transmitter, FL	
TPM transmitter, FR	433 0005503371
TPM transmitter, RL	433 0005639513
TPM transmitter, RR	433 0005283349
Production description control unit	VBV005
Production description	VBV005

M-numbers [Top of page](#)

MNR Type Description

386	XT Bucket Seat (left)
387	XT Bucket Seat (right)
501	Car Cover
572	Manually adjustable air-conditioning system
578	Luggage set terracotta
690	Porsche Online Pro CD-Radio with BOSE Sound system

+

049 130 197 218 270 288 386 387 406 480 482 484 501 535 553 572 578 601 660 661
664 681 690 912 981 983

Version: 003.011.000 / 24.11.2014-16:41

Champion

MOTORSPORT

3101 CENTERPORT CIRCLE
POMPANO BEACH, FL 33064

(954) 946-2136

TOLL FREE 1-800-775-2456

CUSTOMER NO. 1384	ADVISOR TOM	TAG NO. 2288	INVOICE DATE 07/19/22	INVOICE NO. ZZCS7169
	LABOR RATE	LICENSE NO.	MILEAGE 3,445	COLOR
	YEAR / MAKE / MODEL 05/PORSCHE/CARRERA GT/2DR CPE			STOCK NO.
	VEHICLE I.D. NO. W P 0 C A 2 9 8 2 5 L 0 0 1 3 6 4			DELIVERY DATE
	F.T.E. NO. 23-0852963624-4			DELIVERY MILES
	P.O. NO.			SELLING DEALER NO.
COMMENTS			R.O. DATE 06/30/22	PRODUCTION DATE

MO: 3446

JOB# 1 CHARGES-----

LABOR-----

J# 1 14ZZZ Electronics UNITS: 1.00 TECH(S):1571 150.00

CUSTOMER REQUESTS: NEW KEY AND PROGRAMMING. CUST ALSO STATES THAT WHEN VEHICLE IS LOCKED AND SITS, TRANSMITTER DOES NOT UNLOCK DOORS.

REPLACE VEHICLE BATTERY AND CTEK CHARGING CABLE.

==

NEW KEY PROGRAMMED AND TESTED, AS WELL AS REPROGRAMMING OF EXISTING KEY. BOTH KEYS AND FOBs FUNCTIONING NORMALLY. ADVISE CUSTOMER THAT AFTER VEHICLE SITS FOR EXTENDED PERIOD OF TIME, IT MAY BE NECESSARY TO USE PHYSICAL KEY TO UNLOCK DOORS.

REPLACED BATTERY WITH NEW OEM AGM AND NEW CTEK CABLE PER CUSTOMER REQUEST.

--

COMPLETED.

PARTS-----	QTY----	FP-NUMBER-----	DESCRIPTION-----	UNIT PRICE-	
	1	99753893100	BASE KEY	190.79	190.79
	1	98063724406	KEY HEAD	361.78	361.78
	1	992915105B	BATTERY AGM	333.23	333.23
				TOTAL - PARTS	885.80

JOB# 1 TOTALS-----

LABOR 150.00
PARTS 885.80

JOB# 1 JOURNAL PREFIX ZZCS JOB# 1 TOTAL 1035.80

JOB# 2 CHARGES-----

LABOR-----

J# 2 23ZZZ01 Engine Lubrication UNITS: TECH(S):1571 0.00

CUSTOMER REQUESTS OIL AND FILTER SERVICE.

==

COMPLETED.

--

ADVISED CUSTOMER THERE WAS OIL PRESENT ON BOTTOM SIDE OF ENGINE. TECHNICIAN CLEANED ALL SURFACES AND RAN VEHICLE UP TO TEMPERATURE ON LIFT. NO OIL LEAKS FOUND, HOWEVER ADVISED CUSTOMER THAT IT SHOULD BE CHECKED AGAIN AFTER A FEW MORE HEAT CYCLES AND/OR THE NEXT 100-200 MILES OF REGULAR DRIVING.

--

PARTS-----	QTY----	FP-NUMBER-----	DESCRIPTION-----	UNIT PRICE-	
	1	OILCHANGE	OIL CHANGE	475.00	475.00
				TOTAL - PARTS	475.00

JOB# 2 TOTALS-----

PARTS 475.00

JOB# 2 JOURNAL PREFIX ZZCS JOB# 2 TOTAL 475.00

Champion

MOTORSPORT

3101 CENTERPORT CIRCLE
POMPANO BEACH, FL 33064
(954) 946-2136
TOLL FREE 1-800-775-2456

CUSTOMER NO. 1384	ADVISOR TOM	TAG NO. 2288	INVOICE DATE 07/19/22	INVOICE NO. ZZCS7169
	LABOR RATE	LICENSE NO.	MILEAGE 3,445	COLOR
	YEAR / MAKE / MODEL 05/PORSCHE/CARRERA GT/2DR CPE			DELIVERY DATE
	VEHICLE I.D. NO. W P O C A 2 9 8 2 5 L 0 0 1 3 6 4			DELIVERY MILES
	F.T.E. NO. 23-0852963624-4			SELLING DEALER NO.
	P.O. NO.			PRODUCTION DATE
	COMMENTS			R.O. DATE 06/30/22
				MO: 3446

JOB# 3 CHARGES-----

LABOR-----

J# 3 40ZZZ01 Misc Service UNITS: TECH(S):1571 0.00

COMPLETE VEHICLE INSPECTION AND ADVISE OF ANY OTHER
NECESSARY REPAIR ITEMS OR REQUIRED SERVICES.

==

FOUND MISSING LOWER FRONT SPOILER LIP. REPLACED WITH NEW.
COMPLETED CLUTCH MEASUREMENT PER CUSTOMER REQUEST. CLUTCH
MEASURES 29.8, WITHIN SPEC.

PARTS-----QTY---FP-NUMBER-----DESCRIPTION-----UNIT PRICE-

2	900378074A2	HEX SCREW 8	4.13	8.26
4	99970322440	RUBBER PLUG	2.37	9.48
1	98050463101	SPOILER LIP	689.92	689.92
20	99950749740	PLASTIC RIVET	0.80	16.00
			TOTAL - PARTS	723.66

JOB# 3 TOTALS-----

PARTS 723.66

JOB# 3 JOURNAL PREFIX ZZCS JOB# 3 TOTAL 723.66

TOTALS-----

TOTAL LABOR....	150.00
TOTAL PARTS....	2084.46
TOTAL SUBLET...	0.00
TOTAL G.O.G....	0.00
TOTAL MISC CHG.	0.00
TOTAL MISC DISC	0.00
TOTAL TAX.....	0.00
TOTAL INVOICE \$	2234.46

CUSTOMER SIGNATURE